INSTRUCTION MANUAL

Explorer Balances

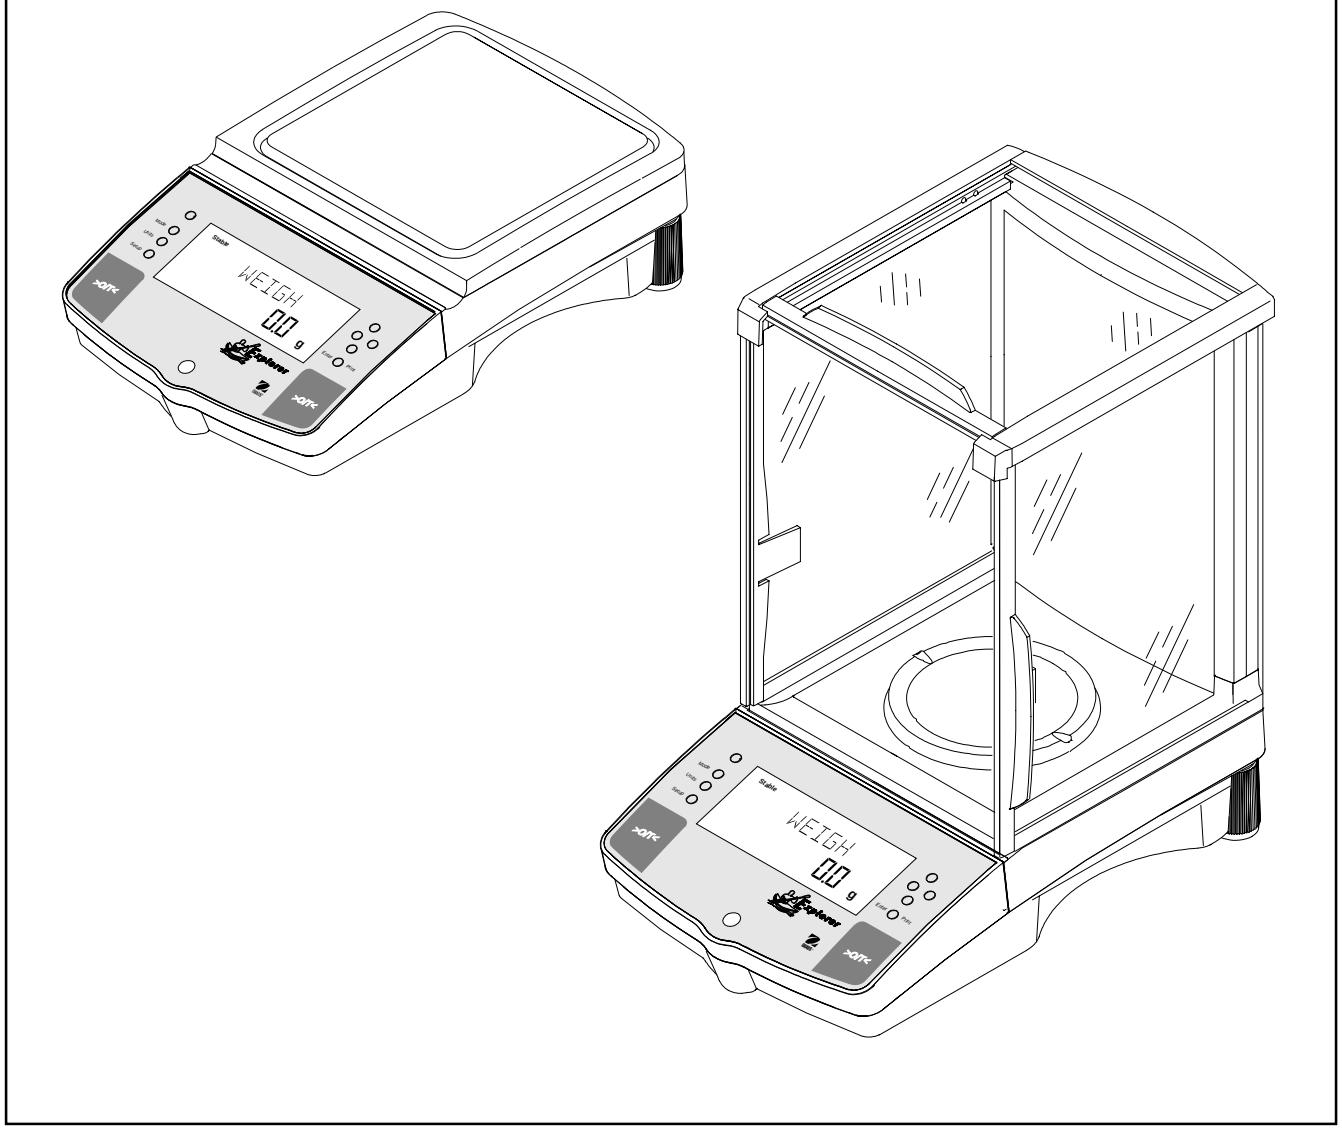

Ohaus Corporation, 19A Chapin Road, P.O. Box 2033, Pine Brook, NJ, 07058-2033, USA

Declaration of Conformity We, Ohaus Corporation, declare under our sole responsibility that the balance models listed below marked with "CE" - are in conformity with the directives and standards mentioned.

Balance model (s) **Explorer/Voyager**

Marked with:	**EC Directive** (Including applicable amendments)	**Standard**
CE Year of attachment of the CE mark: 96	**73/23/EC** Electrical equipment for use within specified voltage limits	**IEC 1010 -1:1990 + A1: 92 + A2: 95** Safety requirements for Electrical Equipment for Measurement, Control Laboratory Use, Part 1: General Requirements
	89/336/EC Electromagnetic compatibility	**EN61326: -1:1997 (class B) + A1: 1998** EMC Emissions, residential, commercial and light industry. **EN61326: -1:1997 A1:1998 (industrial requirements)** EMC Immunity. **EN61000-3-2:1995 + A1:1998 + A2: 1998; EN61000-3-3:1995** EMC Part 3 (for equipment rated input current < or=16A) Limits- Section 2: Limits for harmonic current emissions Limits- section 3: Limitation of voltage fluctuations and flicker in low voltage supply systems
CE 97 122 M T2914	**EU 90/384 NAWI**	**EN45501:1992** Non Automatic Weighing Instruments
	Additional Standards	
C SA US	**CAN/CSA-C22.2 No. 1010.1-92; UL Std. No. 3101-1** Safety requirements for Electrical Equip. for measurement, Control and Laboratory Use, Part 1; General Requirements	
FCC	**FCC, Part 15, class A** Emission	
	AS/NZS4251.1 AS/NZS4252.1 Emission and Immunity	

ISO 9001 Registration for Ohaus Corporation. Ohaus Corporation, USA, was examined and evaluated in 1994 by the Bureau Veritas Quality International, BVQI, and was awarded ISO 9001 registration. This certifies that Ohaus Corporation, USA, has a quality system that conforms with the international standards for quality management and quality assurance (ISO 9000 series). Repeat audits are carried out by BVQI at intervals to check that the quality system is operated in the proper manner.

James Ohaus
President

Ohaus Corporation, Pine Brook, NJ

FCC NOTE: THIS EQUIPMENT HAS BEEN TESTED AND FOUND TO COMPLY WITH THE LIMITS FOR A CLASS A DIGITAL DEVICE, PURSUANT TO PART 15 OF THE FCC RULES.

THESE LIMITS ARE DESIGNED TO PROVIDE REASONABLE PROTECTION AGAINST HARMFUL INTERFERENCE WHEN THE EQUIPMENT IS OPERATED IN A COMMERCIAL ENVIRONMENT. THIS EQUIPMENT GENERATES, USES, AND CAN RADIATE RADIO FREQUENCY ENERGY AND, IF NOT INSTALLED AND USED IN ACCORDANCE WITH THE INSTRUCTION MANUAL, MAY CAUSE HARMFUL INTERFERENCE TO RADIO COMMUNICATIONS. OPERATION OF THIS EQUIPMENT IN A RESIDENTIAL AREA IS LIKELY TO CAUSE HARMFUL INTERFERENCE IN WHICH CASE THE USER WILL BE REQUIRED TO CORRECT THE INTERFERENCE AT HIS OWN EXPENSE.

THIS DIGITAL APPARATUS DOES NOT EXCEED THE CLASS A LIMITS FOR RADIO NOISE EMISSIONS FROM DIGITAL APPARATUS AS SET OUT IN THE INTERFERENCE-CAUSING EQUIPMENT STANDARD ENTITLED “DIGITAL APPARATUS”, ICES-003 OF THE DEPARTMENT OF COMMUNICATIONS CANADA.

CET APPAREIL NUMERIQUE RESPECTE LES LIMITES DE BRUITS RADIOELECTRIQUES APPLICABLES AUX APPAREILS NUMERIQUES DE CLASSE A PRESCRITES DANS LA NORME SUR LE MATERIEL BROUILLEUR: “APPAREILS NUMERIQUES”, NMB-003 EDICTEE PAR LE MINISTRE DES

Unauthorized changes or modifications to this equipment are not permitted.

EC - DECLARATION OF CONFORMITY

Explorer

E10640	E00640	E10645	E00645		
E11140	E01140	E11145	E01145		
E12140	E02140	E12145	E02145		
E1RR80	E0RR80	E1RR85	E0RR85		
E12130	E02130	E12132	E02132	E12135	E02135
E14130	E04130	E14132	E04132	E14135	E04135
E1RV70	E0RV70	E1RV72	E0RV72	E1RV75	E0RV75
E16120	E06120	E16122	E06122	E16125	E06125
E1B120	E0B120	E1B122	E0B122	E1B125	E0B125
E1D120	E0D120	E1D122	E0D122	E1D125	E0D125
E1RW60	E0RW60	E1RW62	E0RW62	E1RW65	E0RW65
E1D110	E0D110	E1D112	E0D112	E1D115	E0D115
E1F110	E0F110	E1F112	E0F112	E1F115	E0F115
E1H110	E0H110	E1H112	E0H112	E1H115	E0H115
E01640	E0A520	E0E122	E15132	E05132	E15135
E16130	E06130	E16135			
E1F120	E0F120	E1F122	E0F122	E1F125	

Voyager

V10640	V00640	V10645		
V11140	V01140	V11145		
V12140	V02140	V12145		
V1RR80	V0RR80	V1RR85		
V12130	V02130	V12132	V02132	V12135
V14130	V04130	V14132	V04132	V14135
V1RV70	V0RV70	V1RV72	V0RV72	V1RV75
V16120	V06120	V16122	V06122	V16125
V1B120	V0B120	V1B122	V0B122	V1B125
V1D120	V0D120	V1D122	V0D122	V1D125
V1RW60	V0RW60	V1RW62	V0RW62	V1RW65
V1D110	V0D110	V1D112	V0D112	V1D115
V1F110	V0F110	V1F112	V0F112	V1F115
V1H110	V0H110	V1H112	V0H112	V1H115
V16130	V06130	V16135		
V1F120	V0F120	V1F122	V0F122	V1F125

New Jersey, 07058, USA
22, Jun. 01

James Ohaus
President

Ohaus Corporation, Pine Brook, NJ

TABLE OF CONTENTS

OVERVIEW OF CONTROLS 1

OVERVIEW OF DISPLAY INDICATORS 2

1. GETTING TO KNOW YOUR BALANCE 3

1.1 Introduction 3

2. INSTALLATION 3

2.1 Unpacking and Checking the Standard Equipment 3

2.2 Selecting the Location 4

2.3 Setting Up and Leveling the Balance 4

2.4 Installing Pan 5

2.5 Wind Shield 5

2.6 Connecting Power 5

3. OPERATING YOUR BALANCE 6

3.1 The Menu (Basic Settings of the Instrument) 6

3.2 Turning On the Balance 7

3.3 Calibration 7

3.3.1 Internal Calibration (InCAL™) 9

3.3.2 Calibration Message 10

3.3.3 Calibration Adjust 11

3.3.4 Span Calibration 12

3.3.5 User Calibration 13

3.3.6 Linearity Calibration 14

3.3.7 Calibration Test 15

3.3.8 Calibration GLP Printout 16

3.4 Weighing 17

3.5 Percent Weighing 18

3.6 Parts Counting 19

3.7 Animal Weighing 20

3.8 Weigh Below 21

3.9 Printing Data 21

4. SETTING UP YOUR BALANCE 22

4.1 Setting Date and Time 22

4.2 Readout 23

4.3 Good Laboratory Practices (GLP) Data 24

4.4 Good Laboratory Practices (GLP) Set 24

TABLE OF CONTENTS (Cont.)

4.5 Print 25
4.6 RS232 27
4.7 Legal for Trade (LFT) 28
4.8 Mode 29
4.9 Units 30
4.10 Global 30
4.11 Custom Unit 32
4.12 Menu Lock-Out Protection 34

5. CARE AND MAINTENANCE 35
5.1 Troubleshooting 35
5.2 RS232 Interface 36
5.3 Error Codes List 39
5.4 Information Messages 39
5.5 Service Information 40
5.6 Replacement Parts 40
5.7 Accessories 40
5.8 Specifications 41

OVERVIEW OF CONTROLS

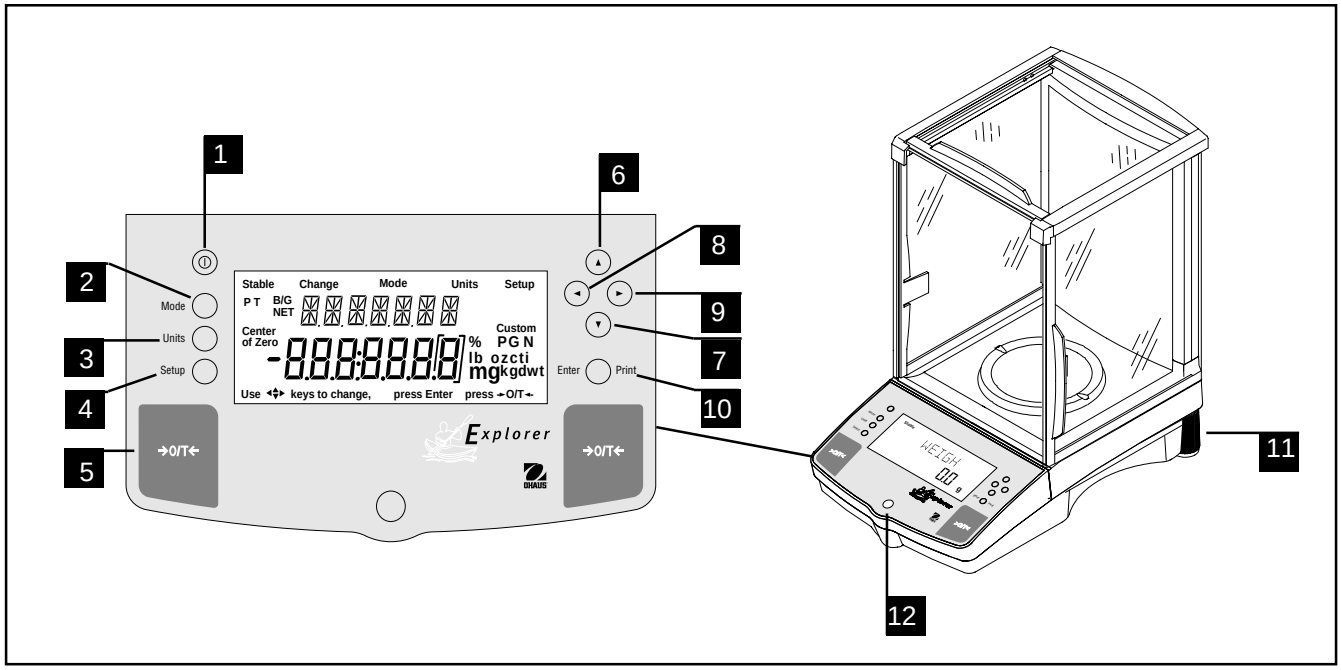

No.	Designation	Function
1	⏻	Power on off button.
2	Mode button	Selects standard weighing, percent, parts counting and animal weighing modes.
3	Units button	Selects weighing units.
4	Setup button	Selects various submenus: calibration, date, time, readout, GLP data, GLP set, print, RS232, LFT, function, units, global, custom.
5	>O/T< button	When pressed, performs tare function and a center of zero function.
6	▲ button	When pressed, travels up through submenus.
7	▼ button	When pressed, travels down through submenus.
8	◄ button	When pressed, travels to the left through menus.
9	► button	When pressed, travels to the right through menus.
10	Enter/Print button	When in menus, selects item on display, otherwise prints data.
11	Leveling feet	Used to level the balance.
12	Leveling indicator	Indicates leveling position of the balance.

OVERVIEW OF DISPLAY INDICATORS

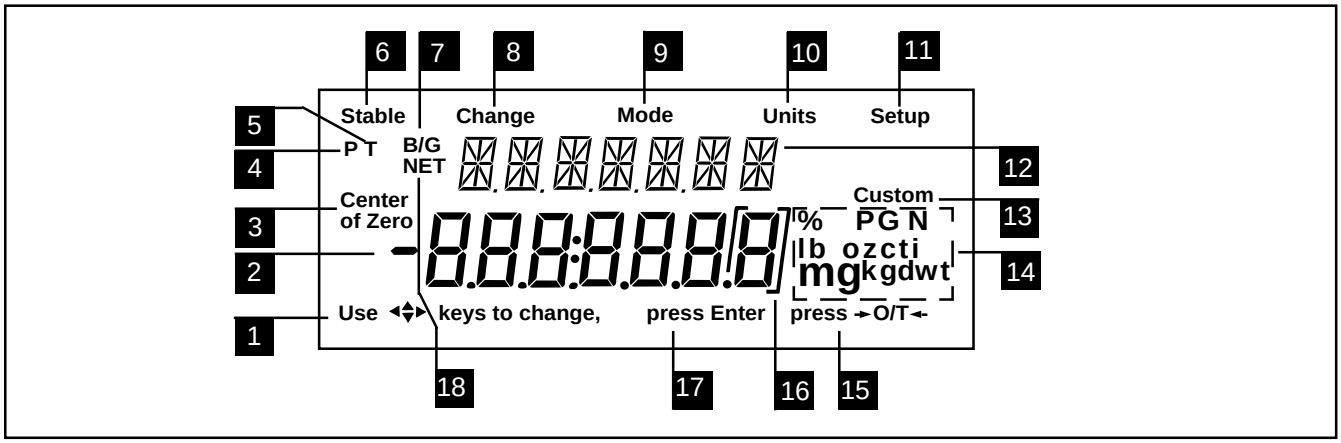

No.	Function
1	**Use** (Pointer Group) **key to change** - used to prompt the user while navigating through the menu system.
2	Standard (7) segment numeric characters. Seven characters are available and are used for displaying weight values.
3	**Center of Zero** - Indicates Center of Zero in Legal For Trade (LFT) has been selected in menu.
4	**P** - This symbol is not used.
5	**T** - This symbol is not used.
6	**Stable** - Indicates that the measured value has become stable.
7	**B/G** - This symbol is not used.
8	**Change** - Is displayed together with **Mode**, **Units** or **Setup** signifying that a change to balance settings is being performed.
9	**Mode** - Is displayed when the **Mode** button is pressed. Allows the user to know what area of the balance menu is being addressed.
10	**Units** - Is displayed when the **Units** button is pressed. Allows the user to know what area of the balance menu is being addressed.
11	**Setup** - Is displayed when the **Setup** button is pressed. Allows the user to know what area of the balance menu is being addressed.

No.	Function
12	(British Flag) - Are (14) segment alpha numeric characters. Seven characters are used to present features and functions.
13	**Custom** - The user can input a factor to meet unique unit measure applications.
14	Symbols for weighing modes, include: **%** - Percent weighing. **PC** - Parts counting. **GN** - Grain. **N** - Newtons. **m** - Mommes. **mg** - Milligrams. **g** - Grams. **kg** - Kilograms. **dwt** - Pennyweight. **lb** - Pounds. **oz** - Ounces. **ct** - Carats. **t** - Taels. Taels are available in three types; Hong Kong, Singapore, and Taiwan. **ti** - Tical. **ozt** - Ounces troy.
15	**press #** -This symbol is not used.
16	⌜⌝ - Differentiated digit for LFT.
17	**press Enter** - Used as a prompt to the user to press the **Enter** button. The menu item displayed is accepted/selected.
18	**NET** - Not Used **NOTE**: Availability of shaded weighing units subject to local regulations.

1. GETTING TO KNOW YOUR BALANCE

Please read through this section carefully, as it contains important information for safe and economical operation of your Explorer Balance.

1.1 Introduction

Thank you for deciding to purchase an Explorer Balance from Ohaus. Thanks to a new modular design, your Explorer Balance lets you adapt the balance to your changing needs. Remote displays, upgraded displays which can be table, wall or tower mounted are available as accessories. It offers a high level of operating convenience and useful functions to make accurate measurements. A unique LCD panel has a large 7 digit, 7 segment display which indicates the weight value of an item being measured and a 7 digit British Flag display (14 segments) which spells out items selected in the submenus. In addition, the display contains English words to indicate the status of the balance. Arrow indicators in the display prompt the user as to what panel keys are to be pressed to initiate a change.

Panel controls are clearly marked as to their function with large Tare buttons on either side of the front panel. Operation and setup of the balance is straightforward and easy. The Explorer Balance is available in a variety of full scale capacities ranging from 62 grams to 8,100 grams with FineRange™ range models available. Legal for Trade versions are available.

Behind your instrument stands OHAUS, a leading manufacturer of precision scales and balances. An Aftermarket Department with trained instrument technicians is dedicated to provide you with the fastest service possible in the event your instrument requires servicing. OHAUS also has a Customer Service Department to answer any inquiries regarding applications and accessories.

To ensure you make full use of the possibilities offered by your Explorer balance, we advise you to read through these operating instructions very carefully.

2. INSTALLATION

2.1 Unpacking and Checking the Standard Equipment

Open the package and remove the instrument and the accessories. Check the completeness of the delivery. The following accessories are part of the standard equipment of your new Explorer balance.

Equipment	Analytical	Top Loader		
	62 g, 110 g, 162 g 210 g, 210/100 g	210, 410, 610 410/100 g	610 g, 1550 g, 2100 g, 4100 g, 6100, 4100/1000 g	6100 g, 4100 g, 8100 g
• **Pan 3.5**	✔			
• **Pan 4.75"**		✔		
• **Pan 6" (0.01 g units)**			✔	✔ *
• **Pan 8" (0.1 g units)**				✔
• **Draft Shield**	✔	✔		
• **Wind Shield (6" Pan Units, 0.01g)**			✔	✔ *
• **AC Power Adapter**	✔	✔	✔	✔
• **Instruction Manual**	✔	✔	✔	✔
• **Warranty Card**	✔	✔	✔	✔

* 4100 g, 6100 g and 8100 g balances with internal calibration are equipped with a 6" Pan and Windshield.

- Remove packing material from the instrument.
- Check the instrument for transport damage. Immediately inform your Ohaus dealer if you have complaints or parts are missing.
- Store all parts of the packaging. This packaging guarantees the best possible protection for the tranport of your instrument.

2.2 Selecting the Location

The balance should always be used in an environment which is free from excessive air currents, corrosives, vibration, and temperature or humidity extremes. These factors will affect displayed weight readings.

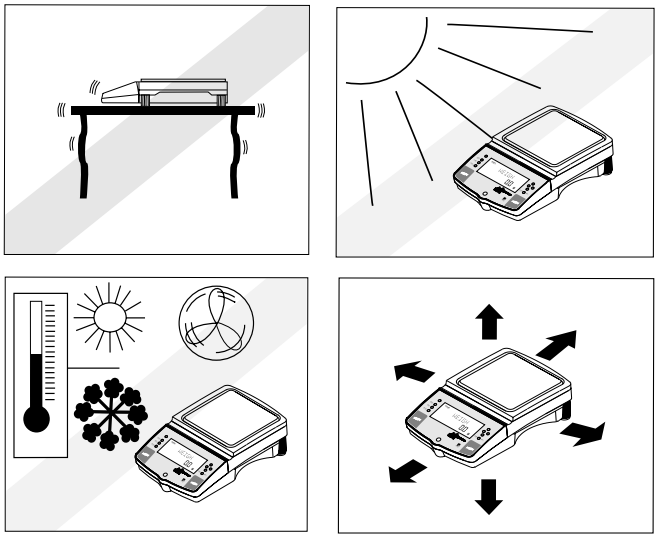

DO NOT install the balance:

- Next to open windows or doors causing drafts or rapid temperature changes.
- Near air conditioning or heat vents.
- Near vibrating, rotating or reciprocating equipment.
- Near magnetic fields or equipment that generates magnetic fields.
- On an unlevel work surface.
- Allow sufficient space around the instrument for ease of operation and keep away from radiating heat sources.

2.3 Setting Up and Leveling the Balance

Exact horizontal positioning and stable installation are prerequisites for repeatable results. To compensate small irregularites or inclinations at the location, the instrument can be leveled.

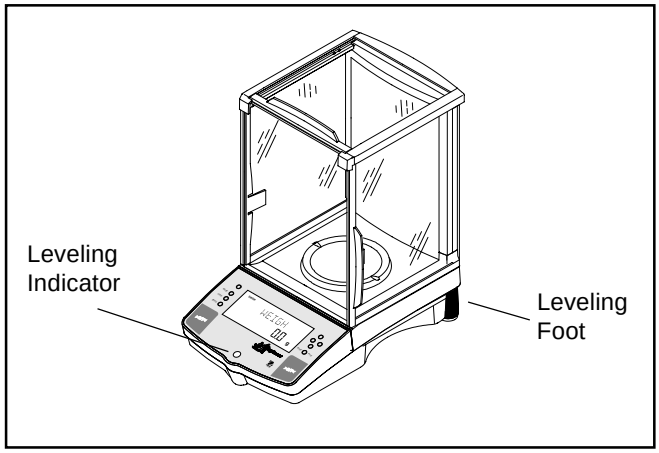

For exact horizontal positioning, the balance is equipped with a level indicator located at the front on the control panel and two leveling feet located at the rear of the balance.

Position the balance in the intended operating location. Adjust the leveling feet at the rear of the balance until the air bubble in the indicator is centered.

NOTE: The instrument should be leveled each time its location is changed.

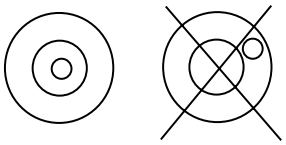

2.4 Installing Pan

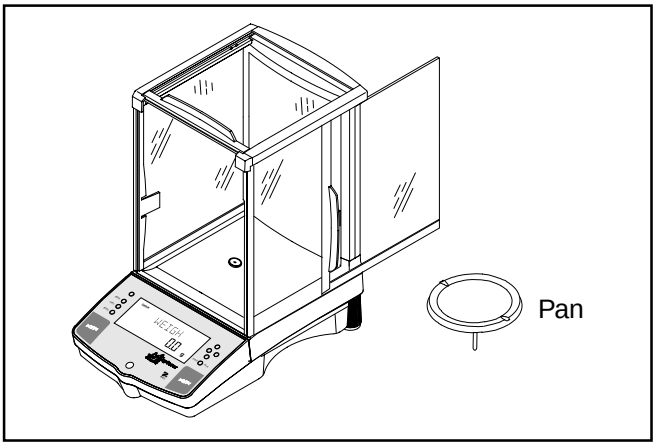

Balances are shipped with the pan not installed. On balances equipped with a draft shield, slide open the side door and insert the pan into the center hole which is the measuring transducer.

2.5 Wind Shield

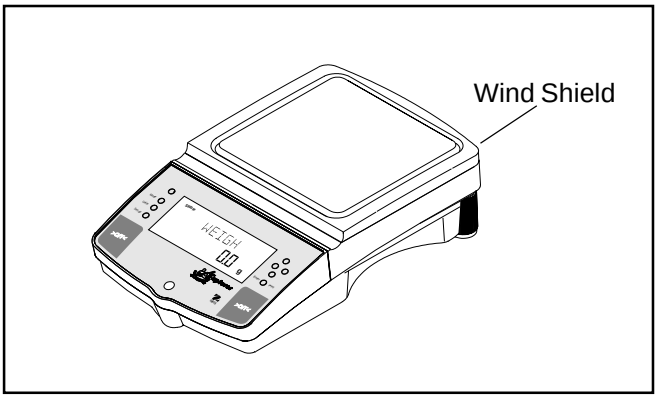

On 610 g to 6100 g balances with 0.01 g resolution, a wind shield is required to reduce the possibility of air currents from disturbing the pan. When the wind shield is in place, air currents are deflected up over the pan. Make sure the wind shield is firmly snapped into place.

NOTE: 4100 g, 6100 g and 8100 g balances with internal calibration are equipped with a 6" Pan and Windshield.

2.6 Connecting Power

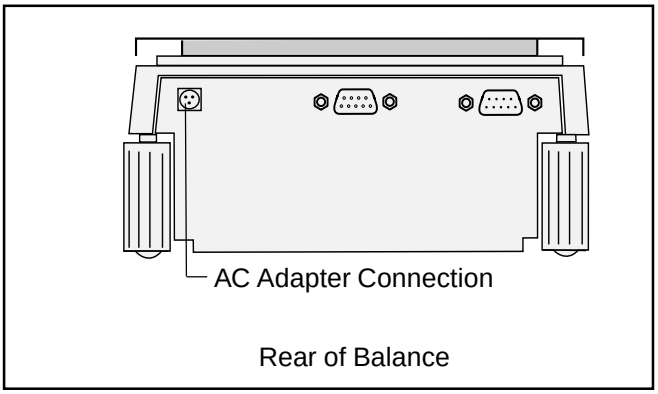

Connect the AC Adapter supplied to the three pin connector located at the rear of the balance.

The balance is now ready for operation.

3 OPERATING YOUR BALANCE

3.1 The Menu (Basic Settings of the Instrument)

The Explorer balance has three basic menus; each is selected by front panel buttons marked **Mode**, **Units** and **Setup**.

Mode Button

The Mode button, when pressed, permits the selection of four weighing modes which are: weigh, percent, count and animal weighing. These modes are controlled by an on or off selection made in the Setup menu under the submenu **Mode** as displayed.

Units Button

The Units button, when pressed, allows the balance to display values in selected measuring unit.

Setup Button

The Setup button, when pressed, allows entry into thirteen submenus which allows you to set the balance for specific operating parameters. Each of the thirteen submenus contain settings which are user selectable. The table below illustrates the various submenus and the functions which are selectable. The items shown on the menu, which are bolded, are the factory default settings. In other words, if you did not enter the Setup menu, the balance would function in the basic manner shown by the various settings which are bolded. The setup submenus shown below are arranged in the order as displayed in the balance.

START **SETUP SUBMENUS**

CALIBRATION
InCAL™ Calibration (No Lock)*
Span Calibration
User Calibration
Linearity Calibration
Calibration Test (No Lock)
Calibration Msg **ON**/OFF
Calibration Adj ± 100 (**0**)
Lock ON/**OFF**
Exit

* (If option is installed.)

DATE
Type **m/d/y**
Set Date
Exit

TIME
Type **12 Hour**/24 Hour
Set Time
Adjust Enter xx seconds
Exit

READOUT	
Filter	-0-, -1-, **-2-**, -3-
Stable	**.**5d, **1d**, 2d, 5d
Auto 0	OFF, .5d, **1d**, 5d
Lock	ON/**OFF**
Exit	

GLP DATA	
User Number	Enter 7 digits
Project Number	Enter 7 digits
Lock	ON/**OFF**
Exit	

GLP SET	
Time	ON/**OFF**
Balance ID	ON/**OFF**
User Number	ON/**OFF**
Project Number	ON/**OFF**
Difference	ON/**OFF**
Name	ON/**OFF**
Lock	ON/**OFF**
Exit	

PRINT	
Auto Print	**OFF**, Cont., Inter, On Stb
Interval	Enter **1** seconds
Stable	ON/**OFF**
Numeric	ON/**OFF**
Print Date	ON/**OFF**
Print Time	ON/**OFF**
Reference	ON/**OFF**
Lock	ON/**OFF**
Exit	

RS232	
Baud	300, 1200, **2400**, 4800, 9600
Parity	**None**, -E-, -Odd-, -0-, -1-
Data	**7**,8
Stop	1, **2**
Lock	ON/**OFF**
Exit	

LFT	
LFT LOCK	ON/**OFF**
(Locked using switch)	

GLOBAL	
List	**NO**/YES
Reset	**NO**/YES
Version	Software No.
Lock	ON/**OFF**

FUNCTION	
Weigh	**ON**/OFF
Percent	ON/**OFF**
Count	ON/**OFF**
Animal	ON/**OFF**
Lock	ON/**OFF**
Exit	

UNITS	
Units	**ON**/OFF
Lock	ON/**OFF**
Exit	

CUSTOM	
Factor	Enter 7 digits
Exponent	Enter +3 to -3
LSD	Enter 0,5 to 100
Lock	ON/**OFF**
Exit	

3.2 Turning On the Balance

The Explorer balance is ready to operate after the installation procedures are performed. When the balance is first turned on and it completes its checks, it can be used to weigh or tare materials without setting the menus.

It is recommended that you read this manual carefully and set the balance to operate for your specific applications using the procedures in Chapter 4 Setting up Your Balance and calibrate the balance before using.

The balance is a high precision instrument and will give you years of service if kept clean and handled carefully. If you have any problems operating the instrument or require additional information, please feel free to contact Ohaus Corporation.

In this section, you will enter the menu for the first time. Do not worry if you are unfamiliar with the function of the buttons on the panel, the display provides the necessary coaching as you go along.

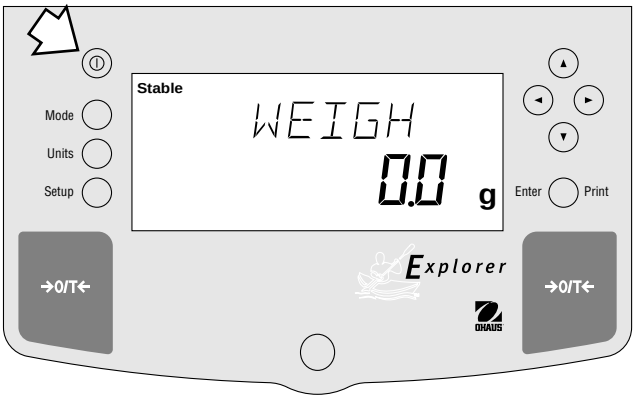

Power On/Off

To turn the balance ON, press the ON/OFF button (circled button with an I inside) located at the upper left-hand corner of the panel once. To turn OFF, press button again.

Stabilization

Before initially using the balance, allow time for it to adjust to its new environment. The balance only requires to be plugged in to warm up. Recommended warm up period is twenty (20) minutes. Analytical Class I balances require at least 2 hours. The internal circuits of the balance are powered whenever it is plugged into a power source.

Calibration

Refer to paragraph 3.3 and calibrate the balance before proceeding.

3.3 Calibration

Explorer balances offer a choice of five calibration methods: Internal Calibration (InCAL™), Span Calibration, User Calibration, Linearity Calibration, and CalTest™.

- ***InCal*** ™ Internal calibration (InCAL™) of the balance is accomplished by an internal mass (If option is installed). When CAL MSG is selected and set ON, CAL NOW is displayed when the balance requires calibration. When CAL MSG is set OFF, the message CAL NOW is not displayed.
- ***Span*** - Span calibration ensures that the balance reads correctly within specifications using two weight values: zero and a weight value at incremental values of full capacity and or 100 % of the balance's full capacity.
- ***User*** - User calibration is a method where the balance can be calibrated using a mass of known value and by entering that numeric value into the balance.
- ***Linearity*** - Linearity calibration minimizes deviation between actual and displayed weights within the balance's weighing range. Three weight values are used: zero, a weight value at midpoint of the balance's weighing range, and a weight value at or near the balance's specified capacity.
- ***Cal Test*** - Calibration test allows the stored calibration data to be tested against the current mass being used for the test.
- ***Lock*** - Can be set on or off. When set on, Span, User and Linearity are locked out and cannot be used.

3.3 Calibration (Cont.)

Calibration Menu Protection
NOTES:

- Calibration may be locked out to prevent unauthorized personnel from changing calibration. If calibration has been locked out, you can only access Cal Test and when installed, Internal Calibration (InCAL™) .
- To lock out calibration menu, after calibration, refer to the section titled Menu Lock-Out Protection.

Calibration Masses
Before beginning calibration, make sure masses are available. If you begin calibration and realize calibration masses are not available, exit the menu. The balance will retain previously stored calibration data. Calibration should be performed as necessary to ensure accurate weighing. Masses required to perform the procedures are listed in the adjacent table.

NOTE:
Any of the calibration modes can be terminated *at any time* by pressing either the **Mode**, **Units** or **Setup** buttons.

CALIBRATION MASSES

CAPACITY	LINEARITY MASSES	SPAN ONLY MASSES
62 g	20g/50 g	50 g
162 g	50g/150 g	150 g
110 g	50g/100 g	100 g
210 g	100g/200 g	200 g
410 g	200g/400 g	400 g
610 g	200g/500 g	500 g
1550 g	500g/1500 g	1500 g
2100 g	1000g/2000 g	2000 g
4100 g	2000g/4000 g	4000 g
6100 g	2000g/5000 g	5000 g
8100 g	4000g/8000 g	8000 g

It is recommended that masses must meet or exceed ASTM Class 1 Tolerance. Calibration masses are available as accessories.

3.3.1 Internal Calibration (InCAL™)

On Explorer balances equipped with the InCal™ feature, calibration can be accomplished using the internal calibration mass. When the balance requires calibration, a screen prompt of CAL NOW appears. This display can be turned off as described in paragraph 3.3.2. Also, a software adjust feature is incorporated which permits the internal calibration mass to be adjusted to ±100 counts. The adjust feature is described in paragraph 3.3.3. Internal calibration can be performed at any time providing the balance has warmed up to operating temperature.

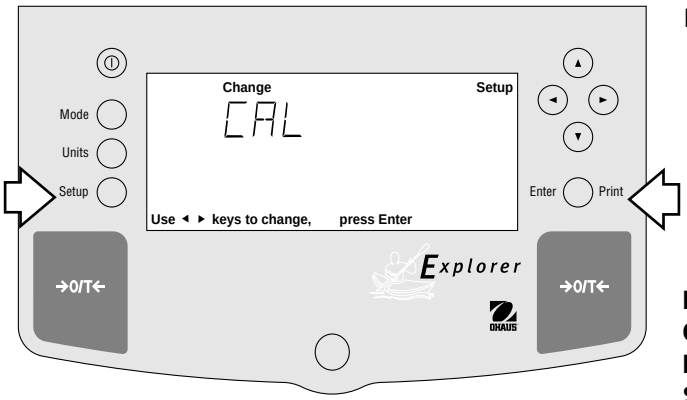

Procedure

- Press the **Setup** button, CAL is displayed.
- Press **Enter** button, CAL TYPE is displayed.
- Press **Enter** button, CAL TYPE InCAL is displayed.
- Press **Enter** button, INCAL is displayed.

IMPORTANT !

DO NOT DISTURB THE BALANCE DURING CALIBRATION. IF THE MESSAGE UNSTBLE IS DISPLAYED, THE BALANCE WAS UNABLE TO ACQUIRE STABLE DATA DURING INTERNAL CALIBRATION. THE BALANCE WILL CONTINUE TO PERFORM INTERNAL CALIBRATION UNTIL READINGS STABILIZE. THE BALANCE WILL THEN COMPLETE THE INTERNAL CALIBRATION FUNCTION.

TO EXIT INTERNAL CALIBRATION MODE BEFORE COMPLETION, PRESS ENTER OR SETUP BUTTONS.

STABILITY CAN BE AFFECTED BY TEMPERATURE, AIR CURRENTS, VIBRATION, ETC...

NOTE: If a weight is left on the pan, the balance will display CLR PAN (remove the weight from the pan). The balance automatically resumes calibration.

The internal mass is positioned several times during calibration and then removed, then after a few seconds, CAL SET is displayed indicating a successful calibration. The display then returns to WEIGH mode.

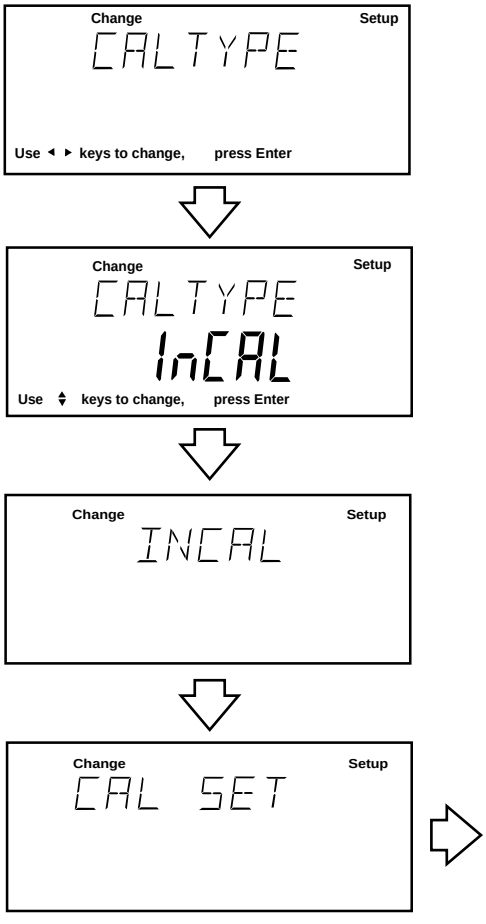

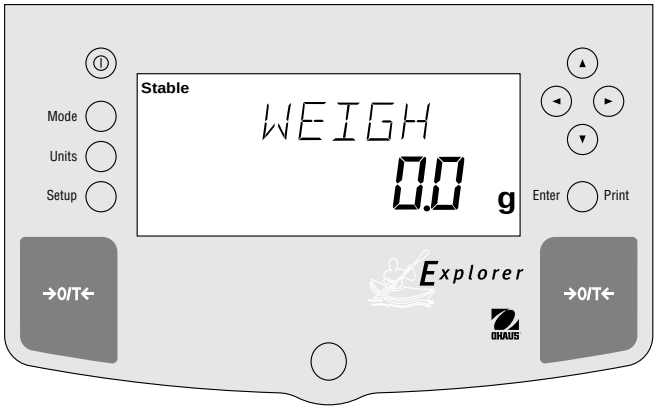

3.3.2 Calibration Message

On Explorer balances equipped with the InCal™ feature, a screen prompt of CAL NOW appears when the balance requires calibration. This display can be turned off if it is desired not to have the balance indicate that calibration is required. Turning the display off has no effect on the basic balance operation.

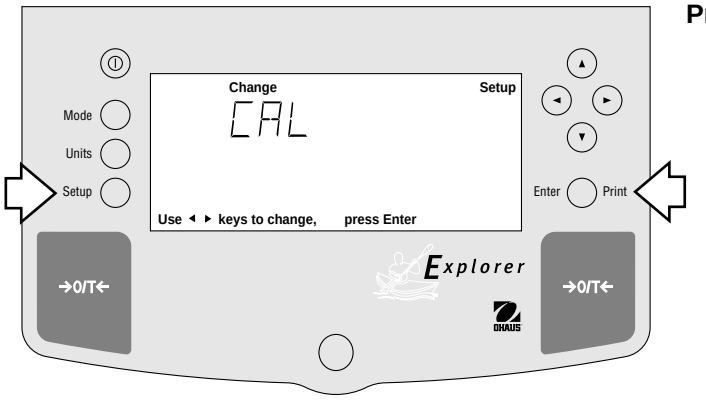

Procedure

- Press the **Setup** button, CAL is displayed.
- Press **Enter** button, CAL TYPE is displayed.
- Press ► button, CAL MSG is displayed.
- Press **Enter** button, CAL MSG ON is displayed.
- Press ▲ or ▼ button and select either ON or OFF. When OFF is selected, the CAL NOW message will not appear in the display.

NOTE: When the balance is in a legal for trade mode, this option is locked ON. In this condition, the balance will display the CAL NOW message when recalibration is required.

- Press **Enter** button, SAVED is momentarily displayed, then the display indicates CAL ADJ.

NOTE: At this point you may continue with the calibration adjust procedure on the next page or exit.

The calibration adjust procedure is only used when it is desired to calibrate the internal calibration mass to a known external Class I mass if a difference exits.

- Press ► button until EXIT is displayed.
- Press **Enter** button, display returns to WEIGH mode.

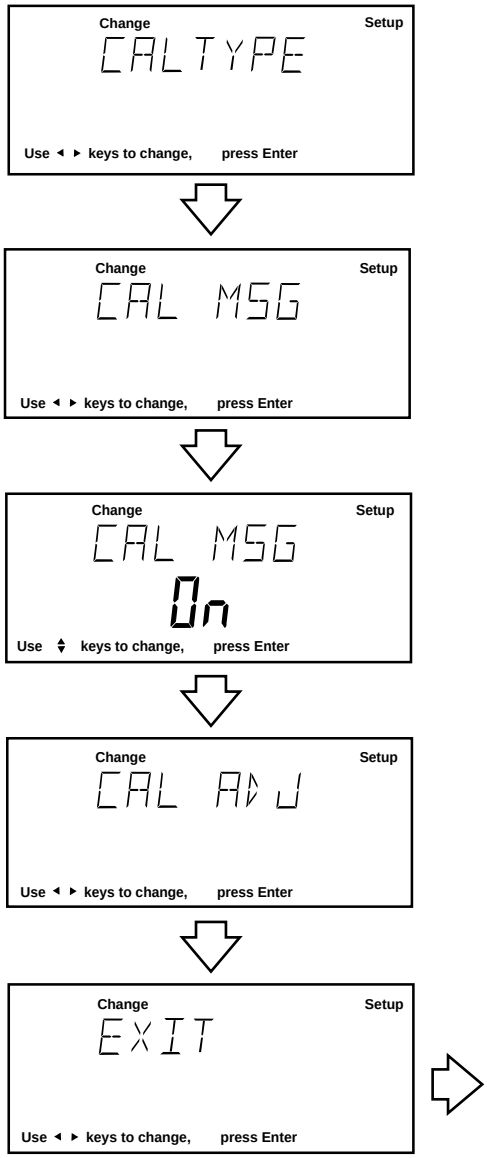

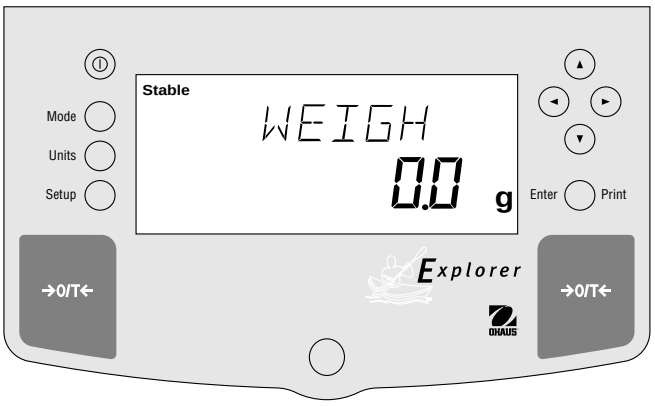

3.3.3 Calibration Adjust

Balances with InCal™ contain software which allows the internal calibration mass to be adjusted ± 100 divisions at full scale capacity. This permits calibrating the balance using an external Class I mass which is traceable to a certified standard.

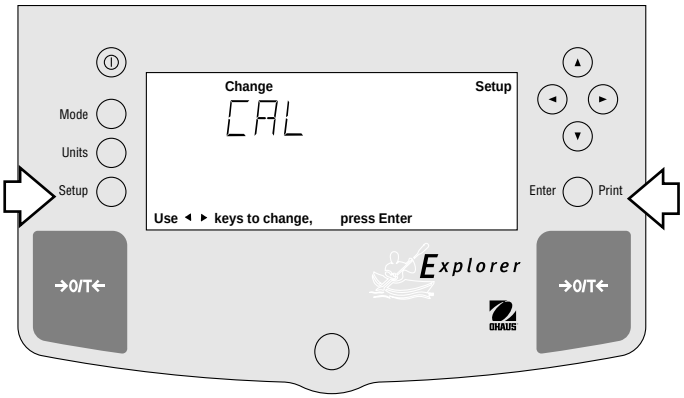

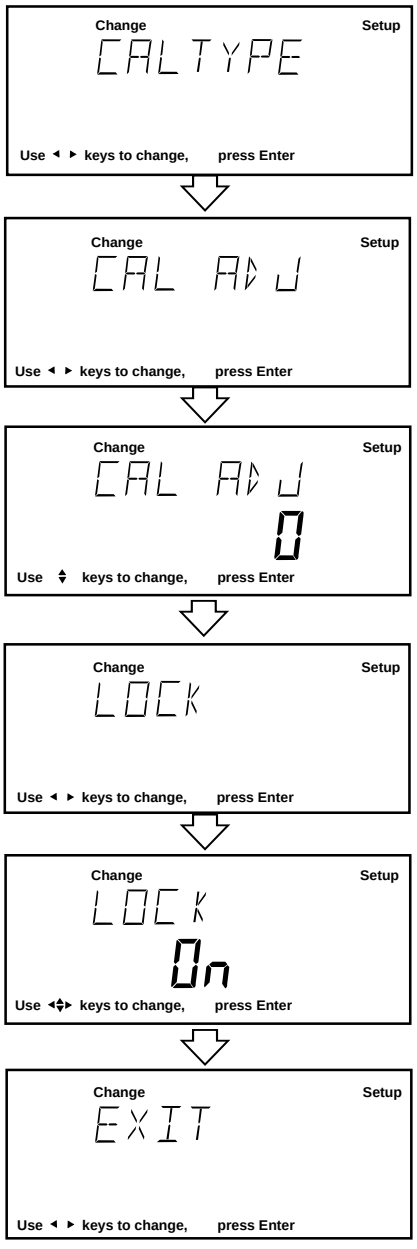

Procedure

- Perform the internal calibration procedure of paragraph 3.3.1.
- Press # button to zero the balance.
- Place a Class I mass equal to the ***span calibration value*** of the balance. Note the reading on the balance and see if the balance indicates the exact weight or indicates a higher or lower reading. If the reading is higher or lower, proceed.
- Press the **Setup** button, CAL is displayed.
- Press **Enter** button, CAL TYPE is displayed.
- Press (►) button until, CAL ADJ is displayed.
- Press **Enter** button, CAL ADJ 0 should be displayed (0 is factory setting).

  NOTE: Balance will retain last CAL ADJ setting.
- Press (▲) or (▼) button until desired number is displayed.
- Press **Enter** button, SAVED is momentarily displayed, then display indicates LOCK.
- Press **Enter** button, LOCK ON or LOCK OFF is displayed.
- Press (▲) or (▼) button and select either LOCK ON or LOCK OFF. LOCK ON is normally used in legal for trade applications. When set ON, and legal for trade is enabled in the balance, the calibration adjust is disabled and whatever setting was entered will remain in the balance.
- Press **Enter** button, SAVED is momentarily displayed, then EXIT is displayed.
- Press **Enter** button, display returns to WEIGH mode.
- Perform the internal calibration procedure of paragraph 3.3.1. The value entered as an adjustment is now stored. Place the calibration mass on the pan and check. Repeat procedure if further correction is required. The display must agree with the mass used for calibration.
- To return to factory setting, follow procedure above and set CAL ADJ to 0.

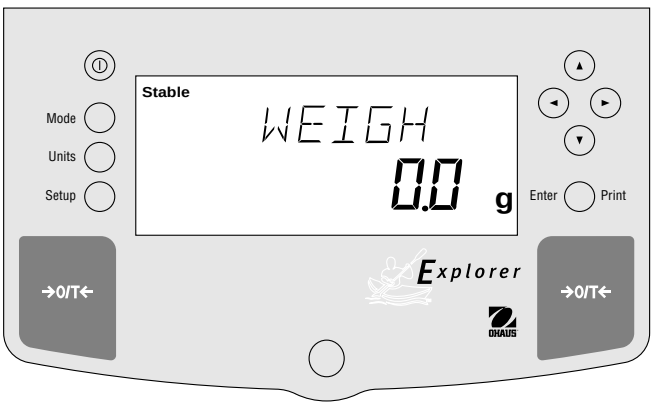

3.3.4 Span Calibration

Span calibration utilizes two calibration points, one at zero and the other at full span or incremental values starting at 25 % of full capacity. As an example, an 8.1 kg balance will accept either 2 kg, 4 kg, 6 kg or 8 kg for span calibration. Values which are below or in between will not be accepted and the balance will display its maximum capacity. When LFT is set on, only full span calibration value can be used. Sample display illustrates an 8.1 kg balance

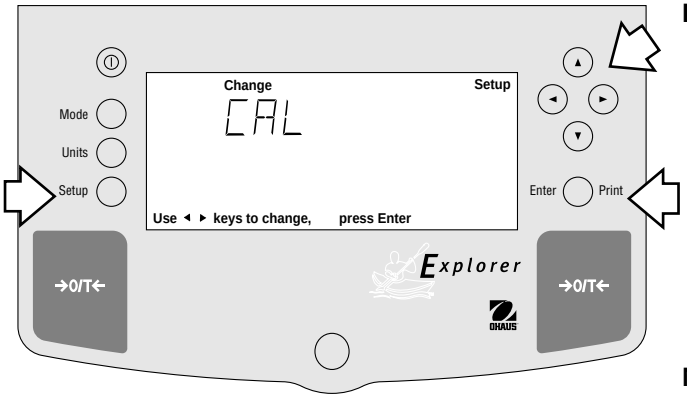

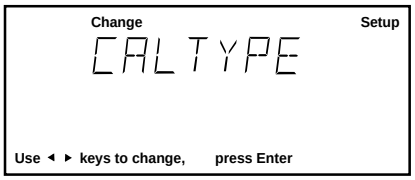

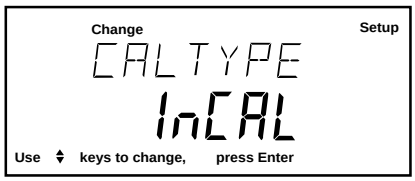

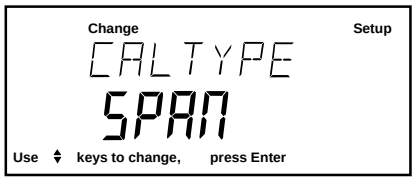

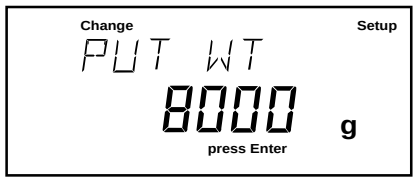

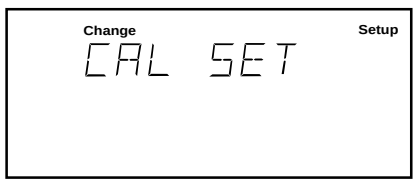

Procedure

- Press the **Setup** button, CAL is displayed.
- Press **Enter** button, CAL TYPE is displayed.
- Press **Enter** button, CAL TYPE InCAL is displayed.
- Press ▲ button to select SPAN calibration, CAL TYPE SPAN is displayed.
- Press **Enter** button, WORKING is displayed.

NOTE: If a weight is left on the pan, the balance will display CLR PAN (remove the weight from the pan). The balance automatically resumes calibration.

- Display changes to PUT WT 8000 g. The displayed weight is the full capacity of the balance.
- Place specified calibration mass on pan.

NOTE: For an 8.1 kg balance, either 2 kg, 4 kg, 6 kg or 8 kg can be used for span calibration. The PUT WEIGHT message indicates the calibration mass that is on the pan.

- Press **Enter** button, WORKING is displayed. After a few seconds CAL SET is displayed, the display then returns to WEIGH mode.
- Span calibration is completed.
- Remove calibration mass from the pan.

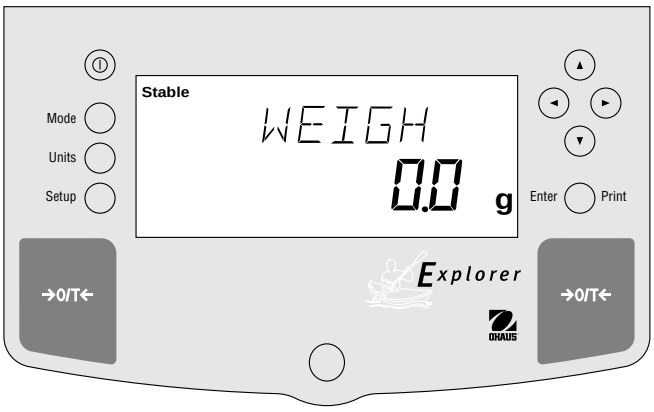

3.3.5 User Calibration

User calibration is used when it is desired to calibrate the balance using a mass of known value. When LFT is set on, the balance will only accept full span calibration, 25 %, 50 % and 75 % values are disabled. To use this calibration feature, proceed as follows:

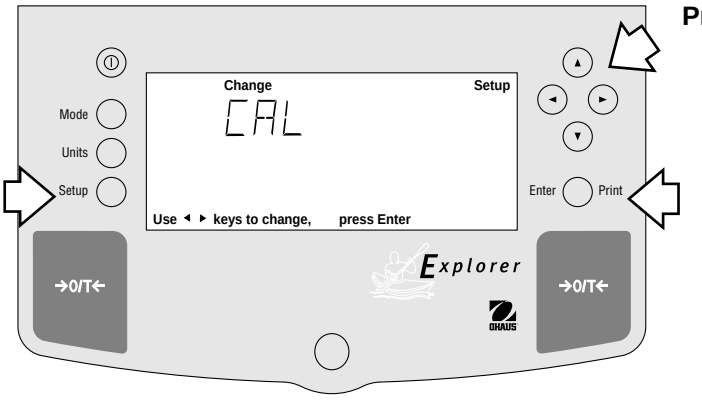

Procedure

- Press the **Setup** button, CAL is displayed.
- Press **Enter** button, CAL TYPE is displayed.
- Press **Enter** button, CAL TYPE InCAL is displayed.
- Press ▲ button twice to select USER calibration, CAL TYPE USer is displayed.
- Press **Enter** button, the display indicates the last calibration mass value which was entered with the first digit flashing. (Sample illustrates 2000 g).
- Press ▲ ▼ and or ◄ ► and enter the desired mass value. This number must be at least 25 % of the full span value.
- Press **Enter** button, WORKING is displayed.

NOTE: If a weight is left on the pan, the balance will display CLR PAN (remove the weight from the pan). The balance automatically resumes calibration.

- Display changes to PUT WT 2000 g.
- Place specified calibration mass on pan.
- Press **Enter** button, WORKING is displayed. After a few seconds CAL SET is displayed, the display then returns to WEIGH mode.
- User calibration is completed.
- Remove calibration mass from the pan.

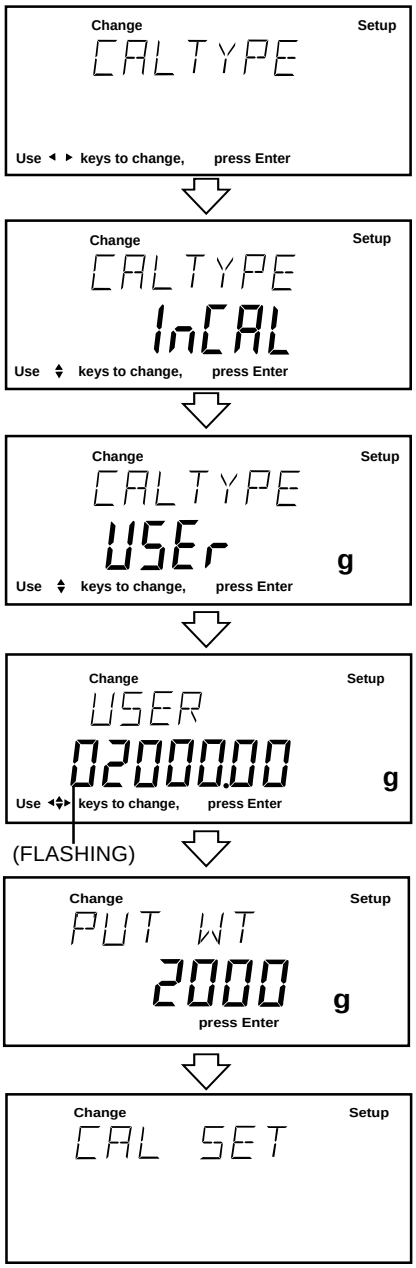

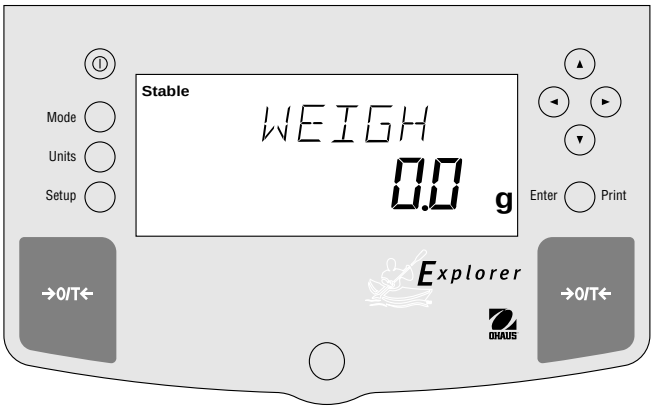

3.3.6 Linearity Calibration

Linearity calibration utilizes three calibration points, one at zero, center span and full span. This method minimizes deviation between actual and displayed weights within the balance's weighing range. Three weight values are used; zero, a weight value at midpoint of the balance's weighing range and a weight value at or near the specified capacity. Sample display illustrates an 8.1 kg balance.

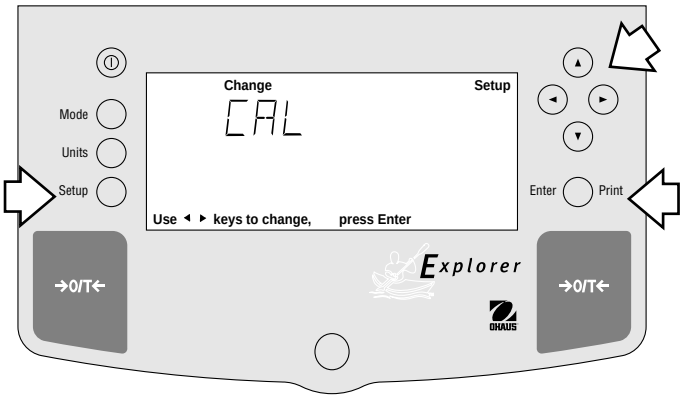

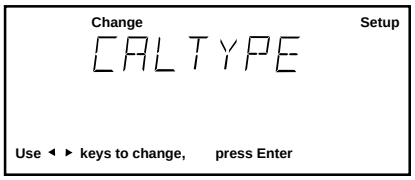

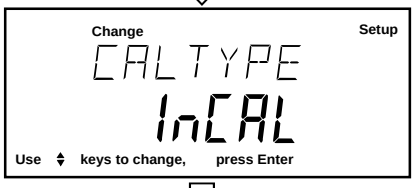

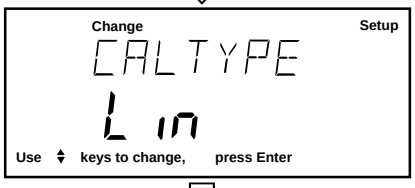

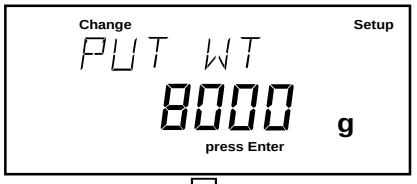

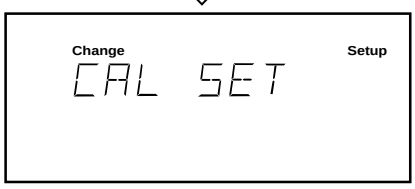

Procedure

- Press the **Setup** button, CAL is displayed.
- Press **Enter** button, CAL TYPE is displayed.
- Press **Enter** button, CAL TYPE InCAL is displayed.
- Press ▲ button three times to select LIN calibration, CAL TYPE Lin is displayed.
- Press **Enter** button, WORKING is displayed.

NOTE: If a weight is left on the pan, the balance will display CLR PAN (remove the weight from the pan). The balance automatically resumes calibration.

- Display changes to PUT WT 4000 g. The displayed weight is half the capacity of the balance.
- Place specified calibration mass on pan.
- Press **Enter** button, WORKING is displayed. After a few seconds display changes to PUT WT 8000 g. The displayed weight is the full capacity of the balance.
- Place specified calibration mass on pan.
- Press **Enter** button, WORKING is displayed. After a few seconds CAL SET is displayed, the display then returns to WEIGH mode.
- Linearity calibration is completed.
- Remove calibration mass from the pan.

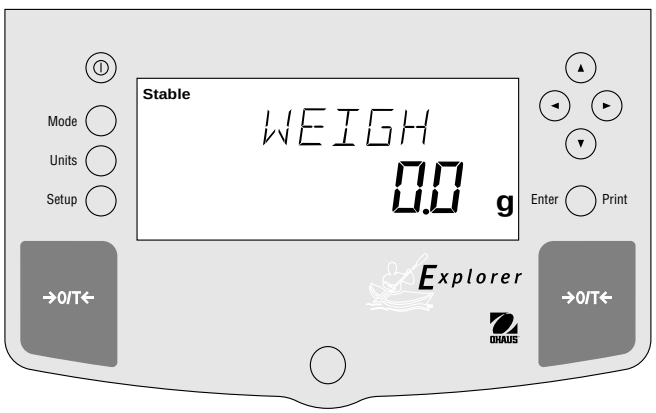

3.3.7 Calibration Test

Calibration test feature allows a check of a known calibration mass against the last stored calibration information in the balance. Sample display illustrates an 8.1 kg balance.

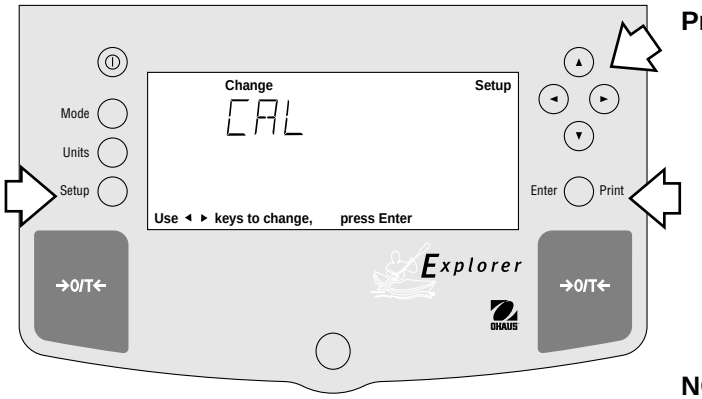

Procedure

- Press the **Setup** button, CAL is displayed.
- Press **Enter** button, CAL TYPE is displayed.
- Press **Enter** button, CAL TYPE InCAL is displayed.
- Press (▲) button to select CALTEST calibration, CALtESt is displayed.
- Press **Enter** button, WORKING is displayed.

NOTE: If a weight is left on the pan, the balance will display CLR PAN (remove the weight from the pan). The balance automatically resumes calibration.

- Display changes to PUT WT 8000 g. The displayed weight is the full capacity of the balance.
- Place specified calibration mass on pan.
- Press **Enter** button, WORKING is displayed. After a few seconds, DIFF is displayed. The display now indicates the actual difference in weight between what value was just placed on the pan and the previous weight value which was stored in the balance. After approximately 8 seconds, the display returns to the WEIGH mode.
- Remove calibration test mass from the pan.

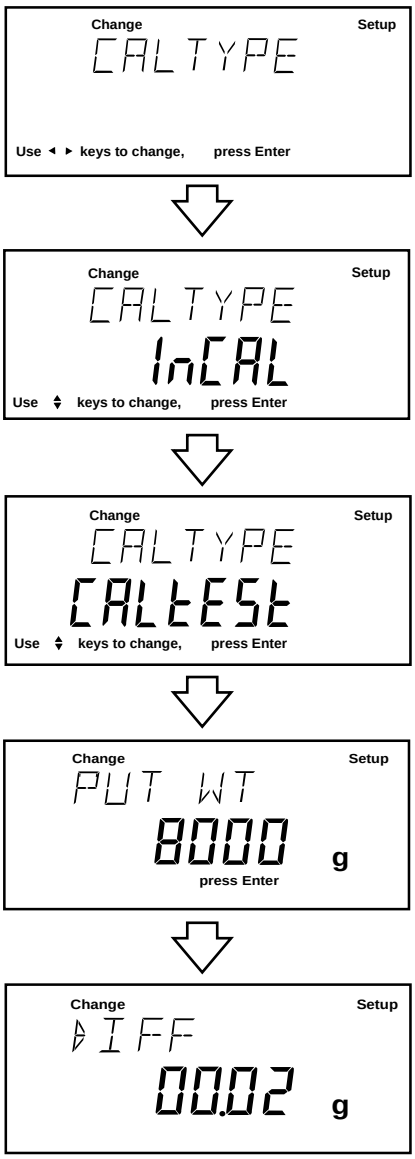

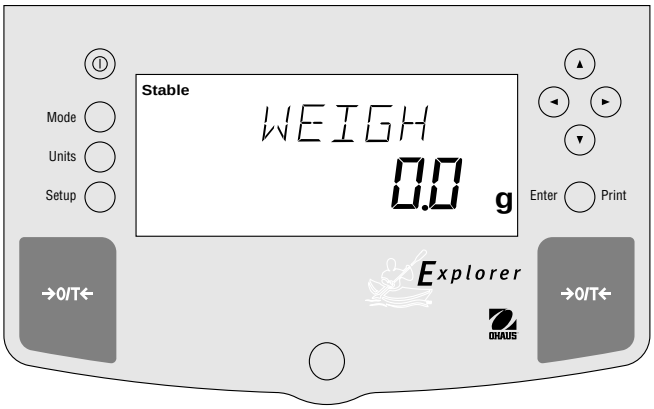

3.3.8 Calibration GLP Printout

If any option in the GLP Set Menu is turned On, GLP automatically prints data after calibration is completed.

Span Calibration Printout

When performing Span calibration with all GLP options turned on, a printout is automatically made after the calibration is completed.

```
- - - - - SPAN CAL - - - - - -
12/01/97    1:00:00 PM
Bal Id  1234
Cal:            8000.00 g
Old:            8000.00 g
Dif:               0.00 g
Wt. Ref.....
USER NO 2056853
PROJ NO 100012
Name.....

- - - - - END - - - - -
```

InCAL™ Calibration Printout

When performing InCAL™ calibration with all GLP options turned on, a printout is automatically made after the calibration is completed.

```
- - - - - INCAL - - - - - -
12/01/97    1:00:00 PM
Bal Id  1234
Cal:            8000.00 g
Old:            8000.00 g
Dif:               0.00 g
Wt. Ref.....
USER NO 2056853
PROJ NO 100012
Name.....

- - - - - END - - - - -
```

Linearity Calibration Printout

When performing a Linearity calibration with all GLP options turned on, a printout is automatically made after the calibration is completed.

```
- - - - - LIN CAL - - - - - -
12/01/97    1:00:00 PM
Bal Id  1234
Cal:            8000.00 g
Old:            7999.08 g
Dif:               0.02 g
Wt. Ref.....
USER NO 2056853
PROJ NO 100012
Name.....

- - - - - END - - - - -
```

Calibration Test Printout

When performing a Calibration Test with all GLP options turned on, a printout is automatically made after the calibration is completed.

```
- - - - - CAL TEST - - - - - -
12/01/97    1:00:00 PM
Bal Id  1234
Cal:            8000.00 g
Act:            8000.02 g
Dif:               0.02 g
Wt. Ref.....
USER NO 2056853
PROJ NO 100012
Name.....

- - - - - END - - - - -
```

3.4 Weighing

NOTE: The Explorer balances are shipped with grams only enabled. When the balance is to be used with other Type Approved/Legal for Trade units of measure, the desired unit must be enabled. Refer to paragraph 4.9 to enable other measuring units.

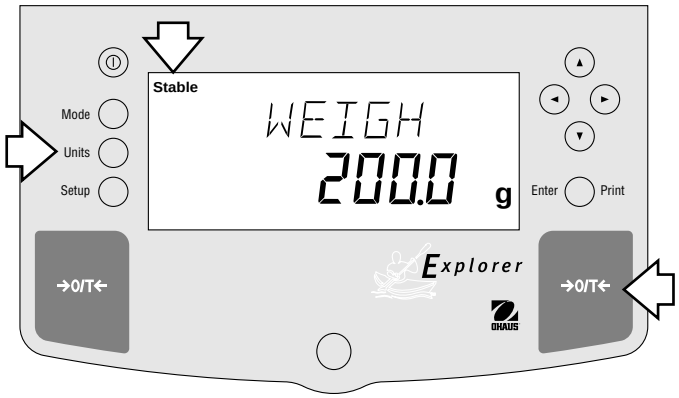

Procedure

- Press **#** to rezero the display.
- Press **Units** button to select measuring unit.
- Press ◄ or ► button for desired measuring unit.
- Press **Enter** button, balance is now ready for weighing.
- Place the object(s) or material to be weighed on the pan. Example illustrates a 200 gram weight.
- Wait for the stability indicator to appear before readingthe weight.

Zero/Tare

When weighing material or objects that must be held in a container, taring stores the container weight in the balance's memory, separate from the weight of the material in the container.

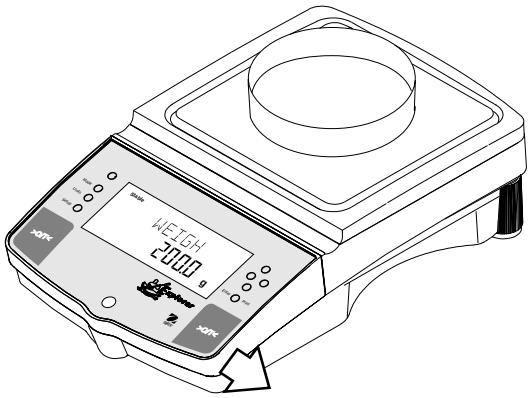

(*Example* Container 200 g)

Procedure

- Press **#** with no load on the pan to set the balance to zero.
- Place an empty container on the pan. Its weight is displayed.
- Press **#** the display blanks until stable weight readings are received, then indicates zero. The container's weight is stored in memory.
- Add material to the container. As material is added, its net weight is displayed.
- Removing the container and material from the platform will cause the balance to display the container's weight as a negative number. The tared weight will remain in memory until **#** is pressed again or the balance is turned off.
- Pressing **#** resets the balance to zero.

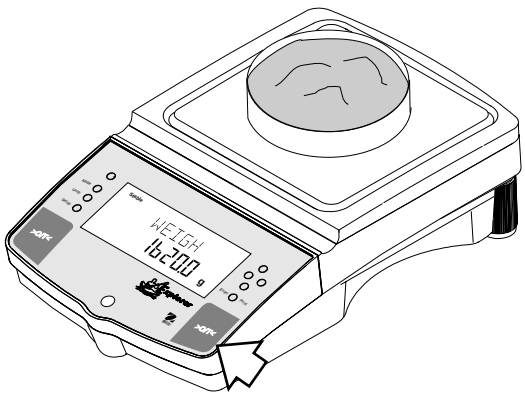

(*Example* Material 1620 g)

NOTE: When Legal for Trade software option LFT NET and LFT LOCK are both set ON, the balance indicates NET WEIGH.

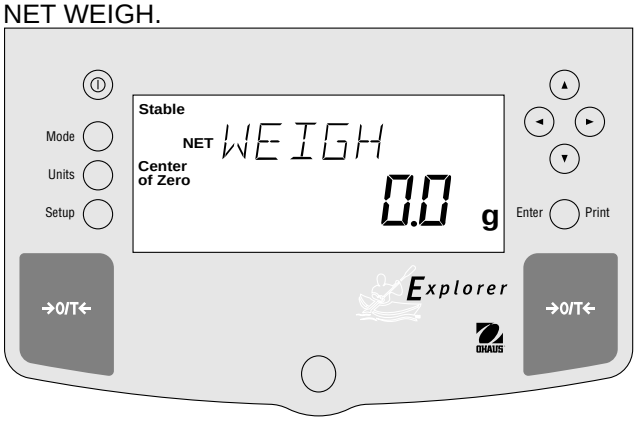

3.5 Percent Weighing

Percent Weighing is ***enabled only*** when Percent is turned ON in the Mode submenu under Setup. Percent weighing permits you to place a reference load on the balance, then view other loads as a percentage of the reference. The load you place on the pan as a reference may be displayed as any percentage you select from 5 % to 100 % (in 1 % increments). One hundred percent does not necessarily have to represent the reference load. Subsequent loads, displayed as a percentage of the reference are limited only by the capacity of the balance. The default setting is Reference 100 %. Refer to paragraph 4.8 to enable percent weighing.

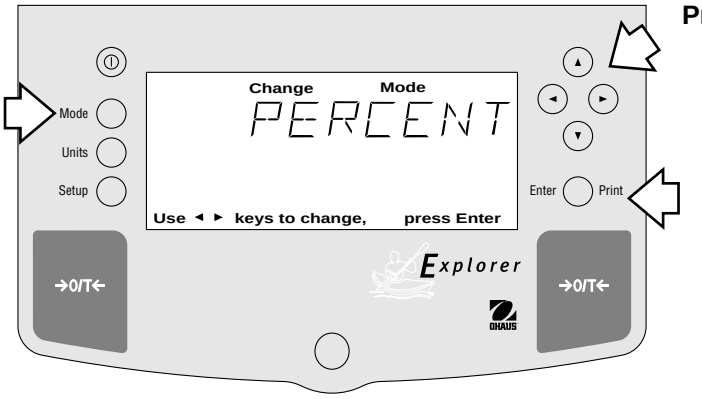

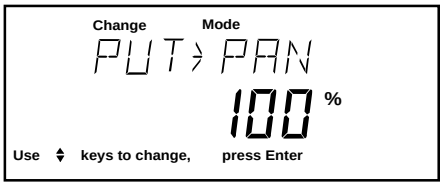

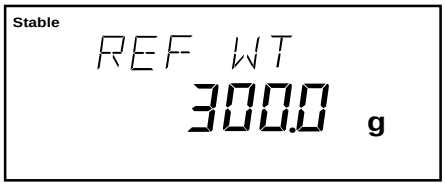

Procedure

- Press the **Mode** button.
- Press ◄ or ► button until PERCENT is displayed.
- Press **Enter** button, PUT>PAN 100 % is displayed. If a container is used, the balance can be tared at this point. The % display momentarily blanks while the balance is taring out.
- Put the reference load on the pan.
- Press ▲ or ▼ button and select reference weight percentage (Percent Range 5 to 100). Hold button down for fast change.
- Press **Enter** button to save setting, WORKING is displayed ... calculating reference weight.

Balance displays reference weight for five seconds in selected measuring unit, then displays the percentage.

- Remove the reference weight from the pan and replace it with another load. The second load is displayed as a percentage of the reference.

NOTE: The PERCENT display (number of digits) is a function of the accuracy of the balance and the size of the reference weight. The display examples were with a 300 g mass used with an 8.1 kilogram balance.

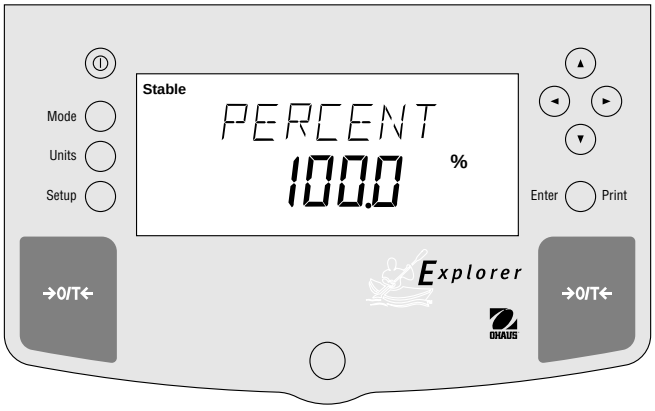

3.6 Parts Counting

Parts Counting is ***enabled only*** when Count is turned ON in the Mode submenu under Setup and selected with the **Mode** button. In the parts counting mode, the balance displays the quantity of parts you place on the pan. Since the balance determines the quantity based on the average weight of a single part, all parts must be reasonably uniform in weight.

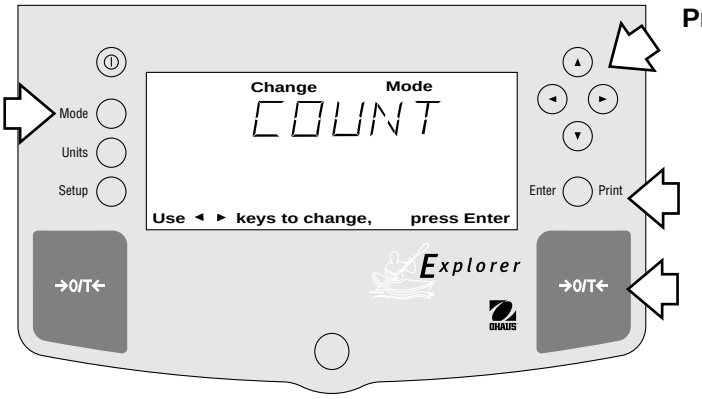

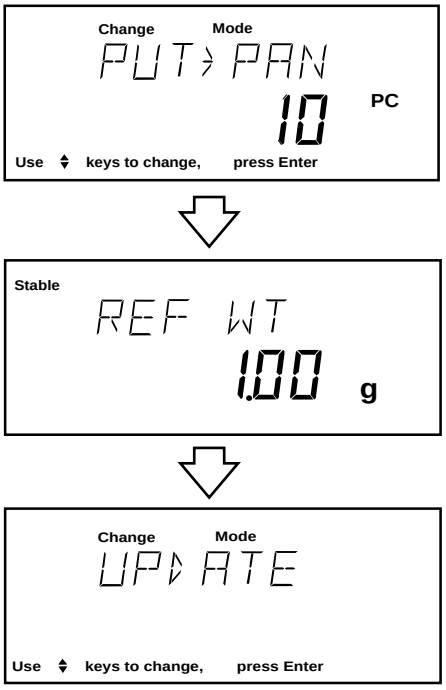

Procedure

- Press the **Mode** button.
- Press ◄ or ► button until COUNT is displayed.
- Press **Enter** button to save setting, PUT>PAN 10 PC is displayed (default setting), balance will retain last sample size saved.
- Press # if taring is required.
- Press ▲ or ▼ button and select sample size. Sample size is 5 to 1000 pieces.
- Place sample size on the pan.
- Press **Enter** button to continue, display indicates WORKING.

Balance displays the reference weight of an individual piece part for five seconds and then displays the total number pieces on the pan.

- Remove the sample and place parts to be counted on the pan. Balance displays number of pieces.

Update

Update is a function which permits placing additional samples which are greater than the value of the original sample but less than three times the value. This action increases the accuracy of the measurement.

- Place sample on the pan which is at least one but not more than three times the original sample size.
- Press **Mode** button, COUNT is displayed.
- Press **Enter** button, UPDATE is displayed.
- Press **Enter** button, WORKING is displayed then the reference weight followed by the new sample size.

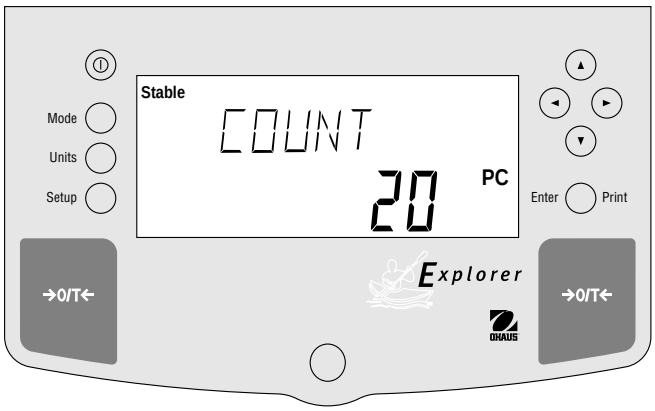

3.7 Animal Weighing

Animal Weighing is ***enabled only*** when Animal is turned ON in the Mode submenu under Setup.

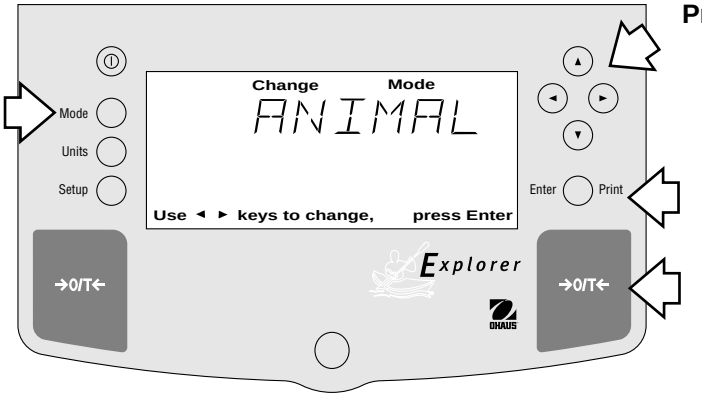

Procedure

- Press the **Mode** button.
- Press ◄ or ► button until ANIMAL is displayed.
- Press **Enter** button to continue, LEVEL is displayed.
- Press ▲ or ▼ button to change animal weighing level, 0, 1, 2 or 3. 0 level represents an inactive subject, 3 is used for a very active subject.
- Press **Enter** button to continue, AUTO is displayed.
- Press ▲ or ▼ button to select AUTO ON or OFF.
- Press **Enter** button to continue.

When the AUTO function is set ON, different subjects can be weighed one after another without pressing any buttons. When the balance displays READY, simply place subject on pan.

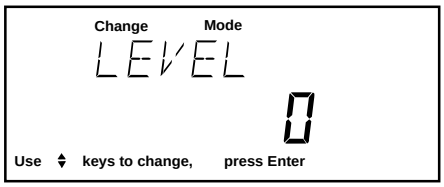

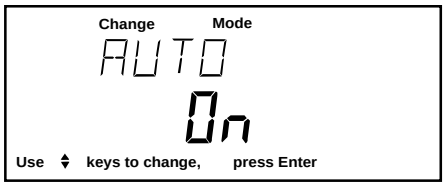

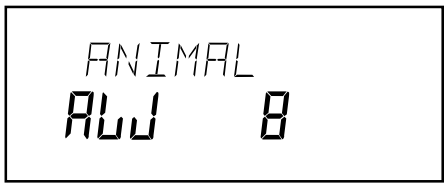

Starting Animal Cycle

- Place animal container if used on pan.
- Press # to tare the container.
- Place subject on pan.
- The animal cycle will automatically start if AUTO was set to ON.
- Press **Enter** button to start animal cycle if AUTO was set to OFF.

During Animal Cycle

- Display shows countdown to AW0.

Completed Animal Cycle

- Balance displays weight until subject is removed from the pan.

3.8 Weigh Below

The Explorer balance is equipped with a weigh below hook at the bottom of the balance. To use this feature, remove power from the balance and remove the protective cover underneath the balance. See illustration for location. The balance can be supported using lab jacks or any other convienent method. Make sure the balance is level and secure. Apply power and operate the balance. Attach items to be weighed to the hook underneath the balance.

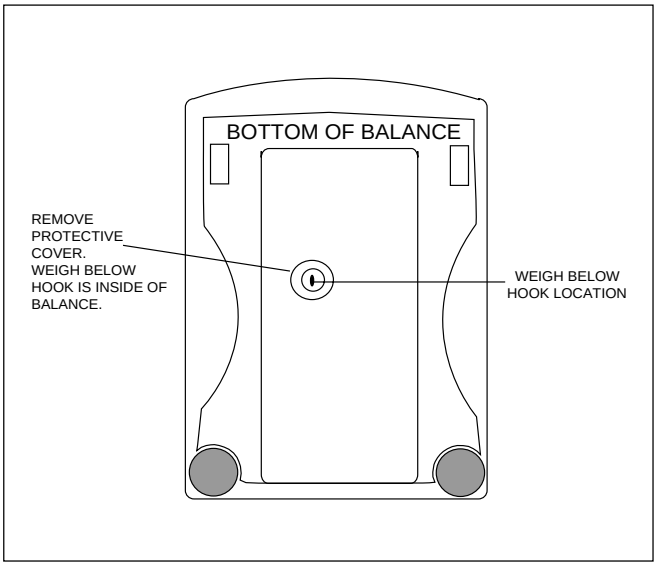

3.9 Printing Data

Printing data to an external computer or printer requires that the communications parameters in the Setup menu, Print options and communication parameters be set first. Refer to page 25 Print menu settings and page 27 for RS232 communication settings.

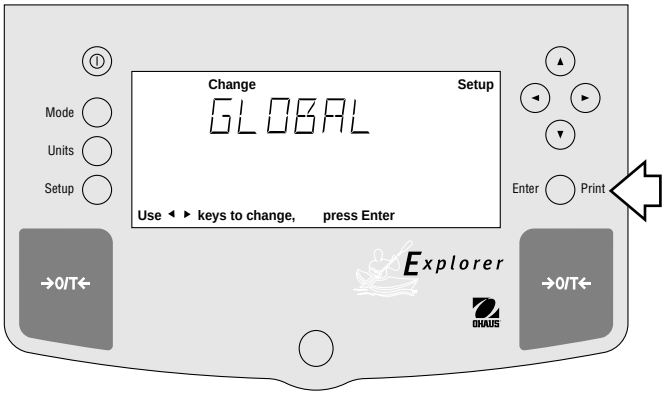

Procedure

- Press the **Print** button. Printing to an external printer or computer will occur each time the Print button is pressed unless autoprint feature is turned on in which case printing can occur in a continuous fashion, at specified intervals or each time a stable reading is achieved.

Sample printout is shown below with time turned on.

SAMPLE PRINTOUT

12/01/97 12:01:37 AM
429.5 g

For a review of of printing samples, refer to Section 4 Setting Up Your Balance. What is printed is controlled by the GLP Set Menu and the selection of GLP Cont. or GLP Tare in the Print Menu.

4. SETTING UP YOUR BALANCE

4.1 Setting Date and Time

Your Explorer balance provides date and time data which can be viewed on a computer or printed out on an external printer. When you put your new instrument into operation for the first time, you should enter the current date and the time. These settings are retained as long as the balance remains connected to a power source.

Date

Date is a feature which enables the balance to be set to a U.S.A. date standard or European date standard. U.S. standard has the month, date, followed by the year, each separated by (/) in the printout. The European date standard has the day first, followed by the month and then the year; each separated by a period. The default setting is **U.S.A. Standard.**

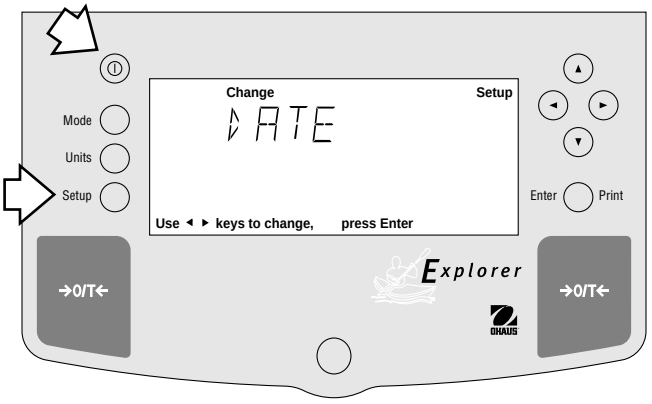

Procedure

- Press the **Setup** button, CAL is displayed.
- Press ◄ or ► button and select Date from the menu.
- Press **Enter** button, TYPE is displayed.
- Press **Enter** button, SET M d y, d M y, y M d, M y d, y d M, or d y M is displayed.
- Press ▲ or ▼ button and select type of date.
- Press **Enter** button, SAVED is displayed, then SET is displayed.
- Press **Enter** button, first digit of date is flashing.
- Using arrow buttons, enter the correct date.
- When the correct date is entered, press **Enter** button, SAVED displays momentarily and EXIT appears.
- Press **Enter** button, balance returns to a weighing mode.

Time

Time is a feature which enables the balance to be set to the current time in either U.S.A. standards (12 hour periods) or European/Military standards (24 hour periods). The default setting is **U.S.A. Standard**.

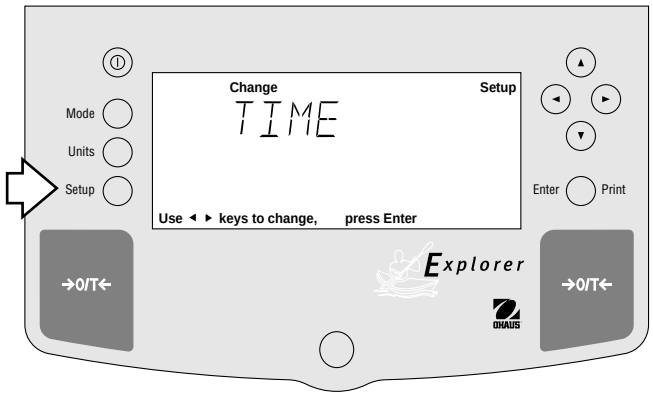

Procedure

- Press the **Setup** button, CAL is displayed.
- Press ◄ or ► button and select Time from the menu.
- Press **Enter** button, TYPE is displayed.
- Press **Enter** button, TYPE 12 hr is displayed.
- Press ▲ or ▼ button and select 12 hr or 24 hr.
- Press **Enter** button, SAVED is displayed momentarily then SET is displayed.
- Press **Enter** button,SET with time is flashing.
- Using arrow buttons, enter the correct time.
- When the correct time is entered, press **Enter** button, SAVED displays momentarily and EXIT appears.
- Press **Enter** button, balance returns to a weighing mode.

Adjustments up to ±60 seconds a month can be made to the balance internal clock. Repeat the first seven steps, ADJUST is displayed. Using arrow buttons, enter time correction and press **Enter** button.

4.2 Readout

The Readout menu is used to adapt the balance to environmental conditions. It contains four submenus: **Stable**, **Auto 0, Filter**, **Lock** and **Exit.** Lock enables you to program balance parameters and to lock the settings.

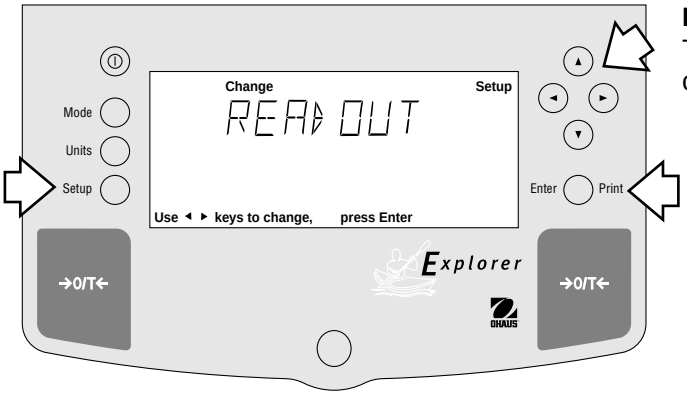

Procedure

To select any of the items in the Readout menu, proceed as follows:

- Press the **Setup** button, CAL is displayed.
- Press ◄ or ► button until READOUT is displayed.
- Press **Enter** button to save setting.
- Press ◄ or ► button until either STABLE, AUTO 0, FILTER, LOCK or EXIT is displayed.
- Press **Enter** button to save setting.
- Press ▲ or ▼ button and select the desired menu setting.
- Press **Enter** button SAVED is displayed.
- Press ◄ or ► button to continue or EXIT.
- Press **Enter** button to save setting.

Stability

The stability range specifies the weighing results and must be within a preset tolerance limit for a certain time to turn the stability indicator ON. When a displayed weight changes beyond the allowable range, the stability indicator turns OFF, indicating an unstable condition. Factory default setting is shown in bold type.

.5 d	Smallest range: stability indicator is ON only when displayed weight is stable within .5 divisions.
1 d	**Reduced range.**
2 d	Normal range.
5 d	Largest range, stability indicator is ON even though displayed weight changes slightly.

When the RS232 interface is configured to print stable data only, the stability range also governs data output. Displayed data will only be output if it is within the selected stability range.

Auto-Zero

Auto-Zero minimizes the effects of temperature changes and shift on the zero reading. The balance maintains the zero display until the threshold is exceeded. Factory default setting is shown in bold type.

OFF	Turns Auto-Zero OFF.
.5 d	Sets threshold to .5 divisions.
1 d	**Sets threshold to 1 division.**
3 d	Sets threshold to 3 divisions.

Filter

Filter compensates for vibration or excessive air currents. Default settings are shown bold.

-0-	reduced stability, fastest stabilization time
-1-	normal stability, normal stabilization time
-2-	**more stability, slow stabilization time.**
-3-	maximum stability, slowest stabilization time.

Lock

Lock ON/OFF can only be changed when the hardware Lock Switch is set OFF/disabled. A menu is locked when the menu lock is set ON and the Lock switch is ON. Lock when selected and turned on, locks all of the entries made under the Readout menu. In the locked condition, items may be looked at but not changed in the menu. When set off, entries may be changed. **OFF** is the default setting.

4.3 Good Laboratory Practices (GLP) Data

The GLP Data submenu enables the storage of a user identification number (7 digits) and/or a project number (digits). When entered into the balance, the identification number and project number are available when printing providing they are turned on in the GLP Set submenu. A lock setting is also available which locks in the user identification and project number.

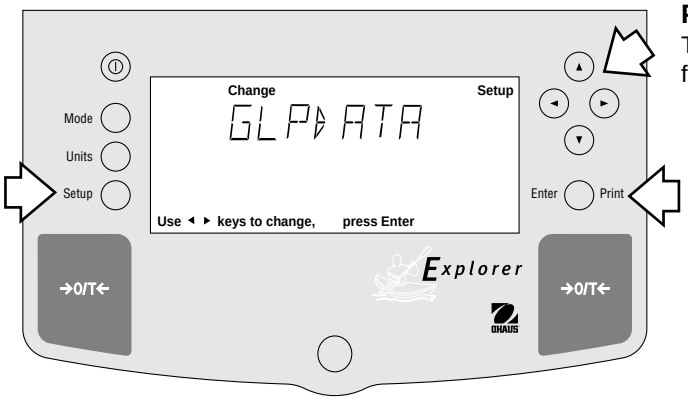

Procedure

To select any of the items in the GLP Data menu, proceed as follows:

- Press the **Setup** button, CAL is displayed.
- Press ◄ or ► button until GLP DATA is displayed.
- Press **Enter** button to continue.
- Press ◄ or ► button until either USER NO, PROJ NO, LOCK or EXIT is displayed.
- Press **Enter** button to continue.
- Press ◄ ► or ▲ ▼ buttons as directed by the display and enter a 7 digit number for the user ID number.
- Press **Enter** button to save setting.
- Press ◄ or ► button until either USER NO, PROJ NO, LOCK or EXIT is displayed.
- Press **Enter** button to continue.
- Press ◄ ► or ▲ ▼ buttons as directed by the display and enter a 7 digit number for the project number.
- Press **Enter** button to save setting.
- Press ◄ or ► button to select next item or EXIT.
- Press **Enter** button to continue.

4.4 Good Laboratory Practices (GLP) Set

Good Laboratory Practices (GLP) Set submenu allows the selection and will permit printing of Time, Balance Identification Number, User Identification Number, Project Number, Difference and Name data to be printed. When the selected items are set to ON, these items are not displayed. The default setting is OFF. When an external printer is used, and all items are set ON and the balance is calibrated, the printer will print out calibration data for audit trail purposes and will indicate date, and time. (It should be noted that the User ID number and Project number must be entered in the GLP Data submenu before printed data is available).

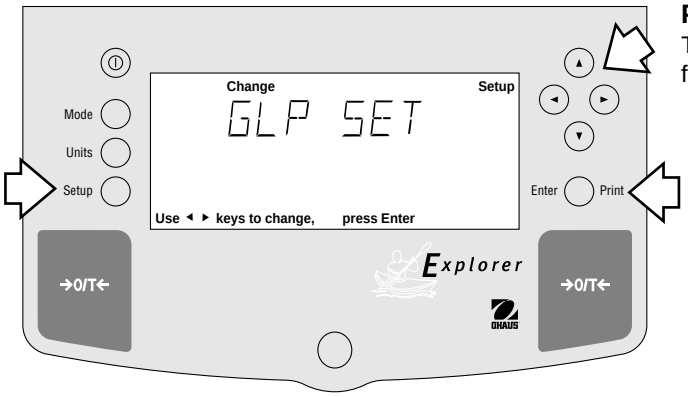

Procedure

To select any of the items in the GLP Set menu, proceed as follows:

- Press the **Setup** button, CAL is displayed.
- Press ◄ or ► button until GLP SET is displayed.
- Press **Enter** button to save setting.
- Press ◄ or ► button until either TIME, BAL ID, USER NO, PROJ NO, DIFF, NAME, LOCK or EXIT is displayed.
- Press **Enter** button to save setting.
- Press ▲ or ▼ button and select either ON or OFF.
- Press **Enter** button to save setting.
- Press ◄ or ► button to continue or EXIT.
- Press **Enter** button to save setting.

4.5 Print

The Print menu provides a number of options which can be turned ON or OFF. It contains eight submenus: **Auto Print,** feature which includes selection of Off, Continuous, Interval and on Stability, **Inter,** specifies time interval for automatic output of displayed data, **Stable** data-only feature, **Numeric** only or full display data for output, **GLPCont, GLPTare**, **Reference** which prints reference weight value and **Lock** which enable you to program balance parameters and to lock the settings.

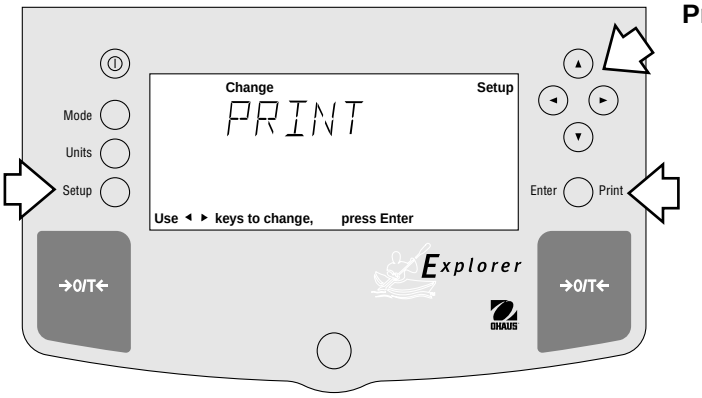

Procedure

- Press the **Setup** button, CAL is displayed.
- Press ◄ or ► button until PRINT is displayed.
- Press **Enter** button to continue.
- Press ◄ or ► button until either AUTOPRT, INTER, STABLE, NUMERIC, GLPCONT, GLPTARE, REFEREN, LOCK or EXIT is displayed.
- Press **Enter** button to continue.
- Press ▲ or ▼ button and select either menu setting or ON or OFF.
- Press **Enter** button to save setting.
- Press ◄ or ► button to select next item or EXIT.
- Press **Enter** button to continue.

Auto Print Feature

When enabled, the Auto Print feature causes the balance to automatically output display data in one of three ways: continuously, at user specified time intervals, or upon stability. Default settings are shown bold.

OFF	**when set on turns off the auto print feature**
Cont	when set on, outputs printed data continuously
Inter	provides a user specified printing interval
On Stb	provides printed data only when a stable reading is achieved

Interval

Can be set to provide a specified printing interval between 1 and 3600 seconds.

Print Stable Data Only

When set On, this feature permits only stable display data to be output. **OFF** is the default setting.

Print Numeric Data Only

When Numeric Data Only function is turned ON, this allows the balance to output numeric data only for RS232 output. **OFF** is the default setting.

4.5 Print (Cont.)

GLP Continuously

When the GLP Continuously function is set ON, allows the balance to output the GLP selections each time a weight value is printed to the printer. **OFF** is the default setting. The following example is with GLP Cont On.

Sample Printout	GLP Set Menu Options Turned On
12/01/97 12:01:37 AM 429.5 g	Time = On
12/01/97 12:01:52 AM Bal Id 429.8 g	Time = On Balance ID = On
12/01/97 12:02:17 AM Bal Id USER NO 1000001 429.8 g	Time = On Bal ID = On User No. = On
12/01/97 12:02:43 AM Bal Id USER NO 1000001 PROJ NO 2000002 429.5 g	Time = On Bal ID = On User No = On Proj No = On
12/01/97 12:02:43 AM Bal Id USER NO 1000001 PROJ NO 2000002 Name . . . . 429.5 g	Time = On Bal ID = On User No = On Proj No = Name = On

GLP Once After Tare

When the GLP Tare function is set ON, allows the balance to output the GLP selections once after tare when the weight value is printed to the printer. **OFF** is the default setting. The following example is with GLP Once After Tare.

	GLP Set Menu Options Turned On
12/01/97 12:01:37 AM 429.5 g 429.6 g 429.7 g 429.7 g 429.7 g	Time = On

Reference

When the Reference function is set ON, prints the value of weight used as a reference in either Percent and Parts Counting modes. **OFF** is the default setting.

Lock

Lock ON/OFF can only be changed when the hardware Lock Switch is set OFF/unlocked. A menu is locked when the menu lock is set ON and the Lock Switch is ON. Lock when selected and turned on, locks all of the entries made under the Print menu. In the locked condition, items may be looked at but not changed in the menu. When set off, entries may be changed. **OFF** is the default setting.

4.6 RS232

The RS232 menu provides communication parameters which can be set to accommodate external printers or computers. It contains five submenus: **Baud** rate, **Parity, Data, Stop** bit and **Lock** ON or OFF which enable you to program balance parameters and to lock the settings.

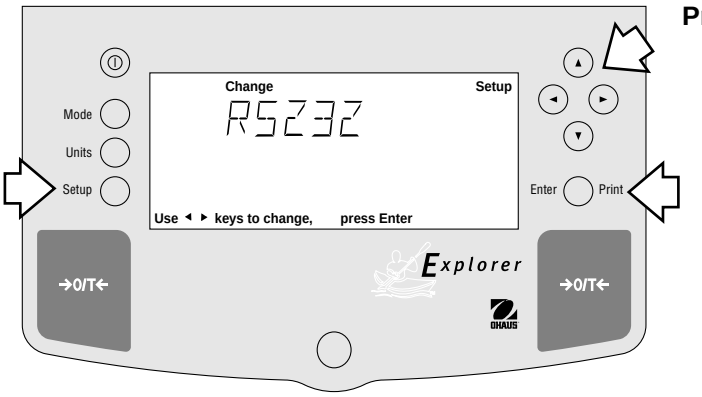

Procedure

- Press the **Setup** button, CAL is displayed.
- Press ◄ or ► button until RS232 is displayed.
- Press **Enter** button to save setting.
- Press ◄ or ► button until either BAUD, PARITY, DATA, STOP, LOCK or EXIT is displayed.
- Press **Enter** button to save setting.
- Press ▲ or ▼ button and select the desired menu setting.

Baud Rate

This submenu is used to select the desired baud rate. There are five available baud rates to choose from: 300, 1200, 2400, 4800 and 9600. The default setting is **2400**.

Parity

Parity can be set to Odd, Even or None. The default setting is **None**.

Data Bits

To set the number of data bits to 7 or 8. The default setting is **7**.

Stop Bits

The number of stop bits can be set to 1 or 2. The default setting is **2**.

Lock

Lock ON/OFF can only be changed when the hardware Lock Switch is set OFF/disabled. A menu is locked when the menu lock is set ON and the Lock Switch is ON. Lock when selected and turned on, locks all of the entries made under the RS232 menu. In the locked condition, items may be looked at but not changed in the menu. When set off, entries may be changed. **OFF** is the default setting.

4.7 Legal for Trade (LFT)

Legal for Trade (LFT) is a software controlled option which can be set to LFT NET and LFT LOCK. When set to LFT NET, the balance will indicate a NET weight during legal for trade operation. When LFT LOCK is set ON, certain items in the Calibration, Readout, Print, Mode and Units menus are automatically preset and locked to permit the balance to operate in a legal for trade application and works in conjunction with a Lock Switch. Default setting is UNLOCKED. See default table.

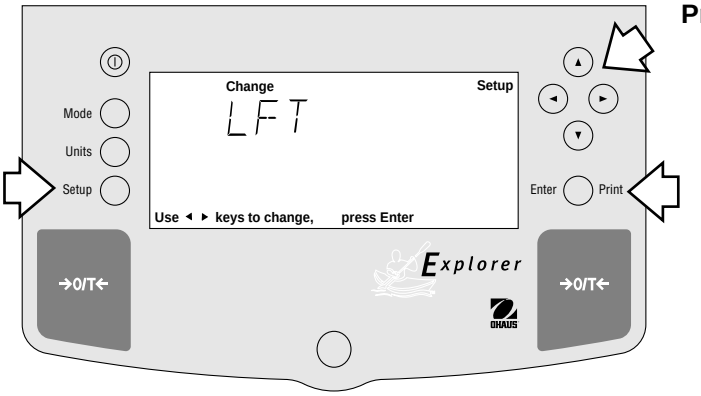

DEFAULT TABLE

LFT and Lock Switch	Menu lock	Default Value
Date Menu	Unlocked	
Time Menu	Unlocked	
Calibration Menu		
Span, Linearity, User	Locked	
CalTest	Unlocked	
Internal Calibration	Unlocked	
Cal Adj	Locked	
Cal Msg	Locked ON	
Readout Menu		
Stability	Unlocked	1d (limited to .5d and 1d)
Auto zero	Unlocked	1d (limited to OFF and .5d)
Filter Level	Unlocked	-2-
GLP Data Menu	Unlocked	
GLP Selections	Unlocked	
Print Options	Unlocked	
RS232 Menu	Unlocked	
LFT Menu	Lockswitch Locked	
Function menu	Locked	Weigh
Units Menu	Locked	Grams*
Global Menu	Locked	
Custom Menu	Unlocked	

* Units oz and oz t cannot be simultaneously enabled.

If Print Numeric Data is turned ON, then Print Stable Data Only is locked ON.

The display check countdown appears during the first 120 seconds after plugging in the balance and only when the balance has been previously set with Type Approved/Legal for Trade ON.

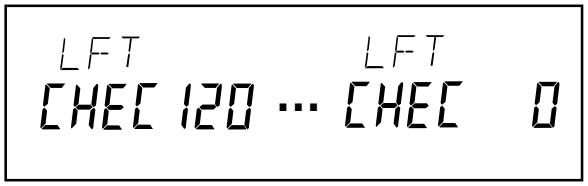

Procedure

- Press the **Setup** button, CAL is displayed.
- Press ► button repeatedly until LFT is displayed.
- Press **Enter** button, LFT NET is displayed.
- Press **Enter** button,LFT NET OFF is displayed.
- Press ▲ or ▼ button and select either ON or OFF.
- Press **Enter** button, SAVED is momentarily displayed, then LFT LOCK is displayed.
- Press **Enter** button, LFT LOCK OFF is displayed.
- Press ▲ or ▼ button and select either ON or OFF.
- Press **Enter** button, SAVED is momentarily displayed followed by EXIT.
- Press **Enter** button, balance returns to weigh mode.

NOTE: For legal for trade applications, the balance must be physically sealed. Refer to section on LFT Sealing.

When the balance is first turned ON and LFT has been previously set ON, the following display will appear if LFT is set in the menu and the Lock Switch is set ON.

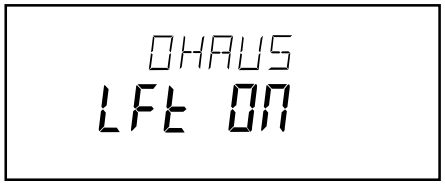

When the balance is first turned ON and LFT has been previously set ON, the following display will appear if LFT is set in the menu and Calibration menu is locked, and the Lock Switch is set ON.

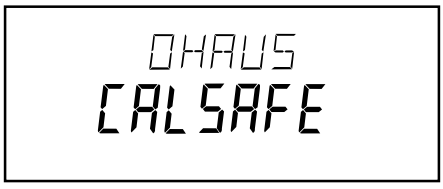

When LFT NET and LFT LOCK are both turned ON, the weigh mode display appears as shown below.

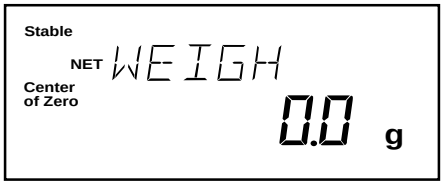

4.8 Mode

The Mode submenu permits the selection of five modes which can be turned ON or OFF. These modes are: **Weigh**, **Percent**, **Count**, **Animal** and **Lock**. Weigh is turned ON and all others have a default setting of **OFF**. When any of the modes are turned ON, they can be selected for operation from the Mode button.

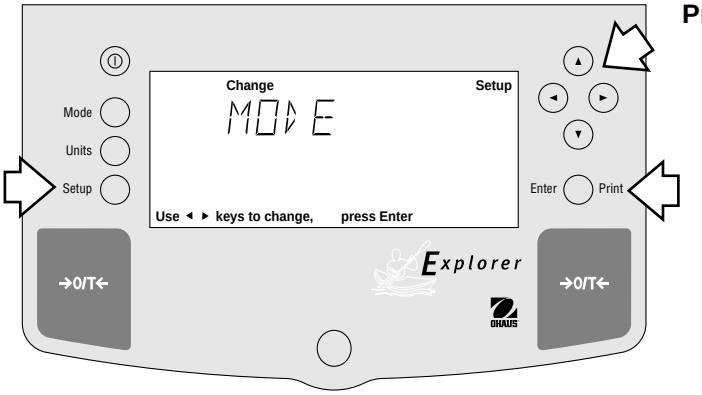

Procedure

- Press the **Setup** button, CAL is displayed.
- Press ◄ or ► button until MODE is displayed.
- Press **Enter** button to save setting.
- Press ◄ or ► button until either WEIGH, PERCENT, COUNT, ANIMAL, LOCK or EXIT is displayed.
- Press **Enter** button to save setting.
- Press ▲ or ▼ button and select either ON or OFF.
- Press **Enter** button to save setting.

Weigh

The Weigh submenu is always set to **ON** as a default.

Percent

Percent weighing permits you to place a reference load on the balance, then view other loads as a percentage of the reference. Selection is made using the **Mode** button. The default setting is **OFF**.

Count

Counting is used when counting quanties of parts. Selection is made using the **Mode** button. The default setting is **OFF**.

Animal

Animal weighing provides special settings to accommodate animal movements. Selection is made using the **Mode** button. The default setting is **OFF**.

Lock

Lock ON/OFF can only be changed when the hardware Lock Switch is set OFF/disabled. A menu is locked when the menu lock is set ON and the Lock Switch is ON. Lock when selected and turned on, locks all of the entries made under the Mode menu. In the locked condition, items may be looked at but not changed in the menu. When set off, entries may be changed. **OFF** is the default setting.

4.9 Units

The Units submenu permits the selection of the measuring units which can be turned ON or OFF and locked.

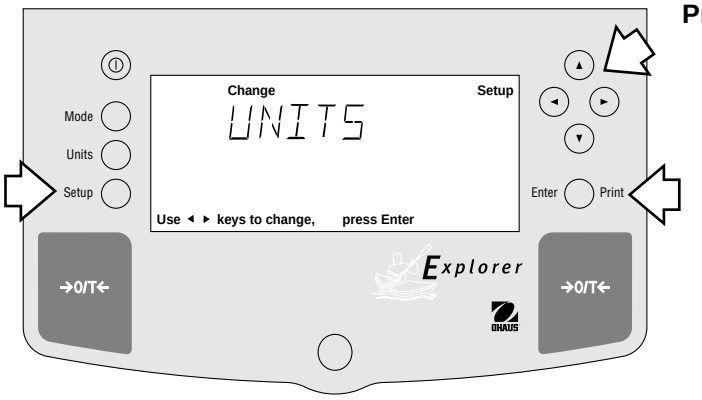

Procedure

- Press the **Setup** button, CAL is displayed.
- Press ◄ or ► button until UNITS is displayed.
- Press **Enter** button to continue.
- Press ◄ or ► button until desired measuring unit is displayed.
- Press **Enter** button to continue.
- Press ▲ or ▼ button and select either ON or OFF.
- Press **Enter** button to save setting.
- Press ◄ or ► button to select next item or EXIT.
- Press **Enter** button to continue.

Units

Measuring units settings are made using the Units button. This menu permits the measuring units to be turned ON or OFF. The default setting is **OFF**.

Lock

Lock when selected and turned on, locks all of the entries made under the Units button. The default setting is **OFF**.

4.10 Global

This menu contains two functions which can be set to either a yes or no type of operation. These functions are: **List**, and **Reset.** The default settings are **NO**. Global List is a convienent method of examining which parameters are set up in the balance. The parameters do not show up on the display but print out when selected. The Global menu contains the List function. When Version is selected, the software revision of the balance is displayed.

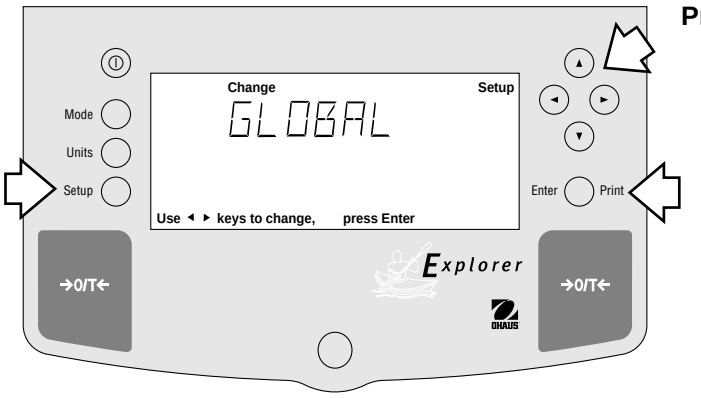

Procedure

- Press the **Setup** button.
- Press ◄ or ► button until GLOBAL is displayed.
- Press **Enter** button to continue.
- Press ◄ or ► button until either LIST, RESET, VERSION, LOCK or EXIT is displayed.
- Press **Enter** button to continue.
- Press ▲ or ▼ button and select either YES or NO for LIST and RESET. When either LOCK or EXIT is selected, ON or OFF settings are available..
- Press **Enter** button to save setting.
- Press ◄ or ► button to select next item or **EXIT**.
- Press **Enter** button to save.

4.10 Global (Cont.)

List

This submenu can be used to output a listing of current menu settings via the RS232 interface. When YES is selected, all menu settings will be output either to an external printer or computer. To use this feature, your balance must be connected to a computer or printer. The default setting is **OFF**.

SAMPLE PRINTOUTS

```
EXPLORER  xxxxxx-xxx
Sr #x.xx  OS#x.xx  G#x.xx

Time= 12hr       3:19:51  PM
Date=  m/d/y      12/01/97
Function = Weigh
ReadOut  Menu
     Stb= 2 d
     AZT= .5 d
     Filter= 1
GLP Menu
     Time/Date= On
     Bal  Id= On
     User  No.= On
     Proj  No.= On
     DIFF=  On
     Name=  On
Print Menu
     Auto Print=  Off
     Interval=  7
     Stable Print=  On
     NU=  On
     GLP Cont =  Off
     GLP on Tare =  Off
     Print Ref=  On
RS232 = 2400: N: 7: 2
```

The partial sample shown, indicates the status in the menus.

```
LFT  is Off
Mode Menu
   WEIGH= On
   PERCENT= Off
   COUNT=  Off
   ANIMAL=  Off
Lock Switch is Off
Menu Locks
   RS232=  Off
   READOUT=  Off
   GLPSET=  Off
   MODE=  Off
   UNITS=  Off
   PRINT= Off
   GLP Data = Off
   CAL=  Off
   GLOBAL= Off
   CUSTOM= Off
Enabled Units:
   g
   custm
C. Units:
   1.000000  E0 x 1
```

Reset

Reset when set to YES will reset the balance to factory default settings. The default setting is **NO**.

Version

Displays software revision number for servicing purposes. This number is installed with the balance.

Lock

Lock when selected and set to ON, locks all of the entries made under the Global menu. The default setting is **OFF**.

4.11 Custom Unit

Custom Unit is enabled when Custom Unit Setup under Units Menu is turned ON. This feature can be used to create your own custom weighing unit. It permits entering a conversion factor which the balance will use to convert grams to the desired unit of measure.

Conversion Factor	x	Weight in grams	=	Weight in custom unit

Conversion factors are expressed in scientific notation and entered into the balance in three parts:

- a number between 0.1 and 1.999999 called the mantissa
- a power of 10 called the exponent
- a least significant digit (LSD)

SCIENTIFIC NOTATION

Conv. Factor		Number Between 0.1 and 1.999999		Power of 10		Mantissa	Exp.
123.4	=	.1234	x	1000	=	.1234 x	10^3
12.34	=	.1234	x	100	=	.1234 x	10^2
1.234	=	.1234	x	10	=	.1234 x	10^1
.1234	=	.1234	x	1	=	.1234 x	10^0
.01234	=	.1234	x	.1	=	.1234 x	10^{-1}
.001234	=	.1234	x	.01	=	.1234 x	10^{-2}
.000123	=	.123	x	.001	=	.123 x	10^{-3}

EXPONENTS

E-3	Moves decimal point 3 places to the left.
E-2	Moves decimal point 2 places to the left.
E-1	Moves decimal point 1 place to the left.
E0	**Leaves decimal point in normal position.**
E1	Moves decimal point 1 place to the right.
E2	Moves decimal point 2 places to the right.
E3	Moves decimal point 3 places to the right.

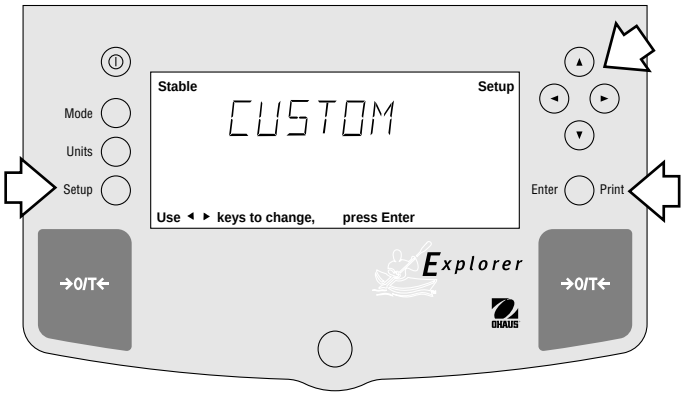

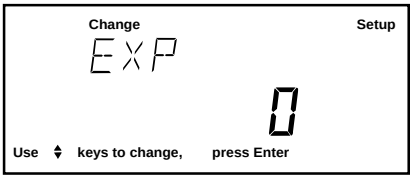

Procedure

- Press the **Setup** button.
- Press ◄ or ► button until CUSTOM is displayed.
- Press **Enter** button to save setting, FACTOR is displayed.
- Press **Enter** button, The mantissa of the current conversion is displayed. The mantissa of the current conversion factor is displayed. This is a number between 0.1 and 1.999999 with the first digit flashing. For conversion factors outside of this range, the exponent will be used to move the decimal point.
- Press ◄ ► or ▲ ▼ buttons as directed by the display and enter a 7 digit number for the conversion factor.
- Press **Enter** button, EXP (exponent) is displayed.
- Press **Enter** button, 0 (exponent) is displayed.
- Press ▲ or ▼ button and select exponent value either -3, -2, -1, 0, 1, 2, or 3.

4.11 Custom Unit (Cont.)

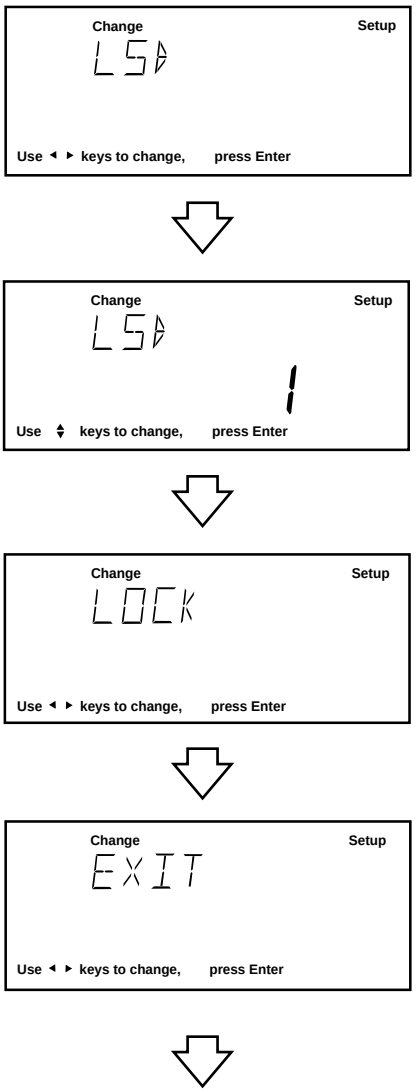

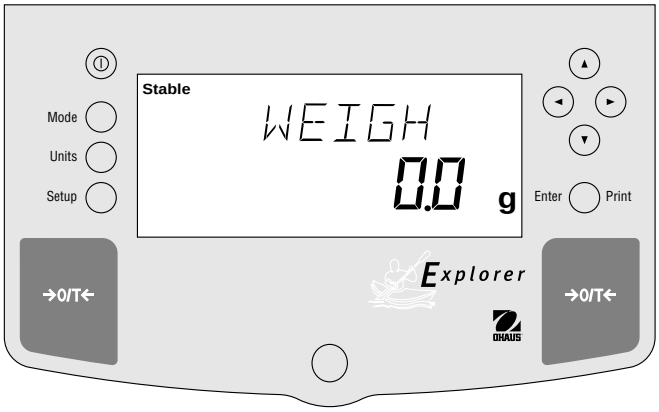

LSD's	
LSD .5	Adds one decimal place display counts by 5's.
LSD 1	**Display counts by 1's.**
LSD 2	Display counts by 2's.
LSD 5	Display counts by 5's.
LSD 10	Display counts by 10's.
LSD 100	Display counts by 100's.
* Sensitivity to vibration is increased with this LSD setting.	

Procedure (Cont.)

- Press **Enter** button to save setting, LSD is displayed. There are 6 LSD (least significant digit) settings you can choose from (see table).
- Press **Enter** button, LSD 1 is displayed.
- Press ▲ or ▼ button and select LSD value either 1, 2, 5, 10 or 100.
- Press **Enter** button, SAVED is momementary displayed followed by LOCK.
- Press ▲ or ▼ button and select ON or OFF.
- Press **Enter** button, EXIT is displayed.
- Press **Enter** button to return to weighing mode.

4.12 Menu Lock-Out Protection

Access to the various menus can be disabled setting the Lock Switch located on the PC board inside the balance to OFF position. The Lock Switch locks out all menus which have had LOCK turned ON. The default setting for the Lock Switch is OFF.

Type Approved/Legal for Trade Balance Sealing

"Certified balances have a securing sticker applied at the factory. When subsequent verification is carried out, they can be sealed either with a lead seal and wire, or with a new securing sticker".

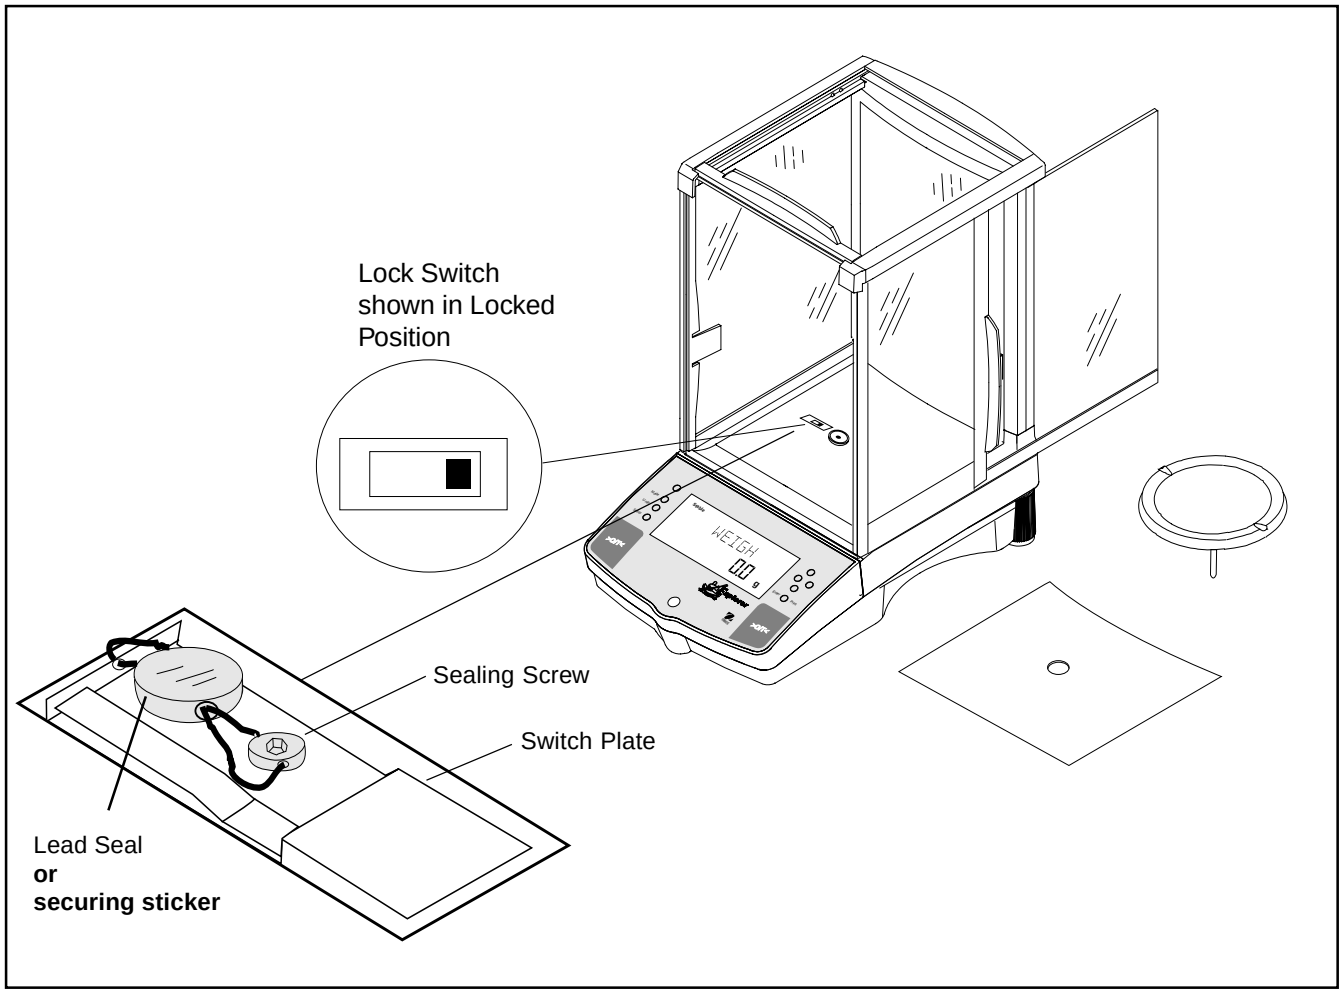

Example of Sealing Method

5 CARE AND MAINTENANCE

To keep the balance operating properly, the housing and platform should be kept clean and free from foreign material. If necessary, a cloth dampened with a mild detergent may be used. Keep calibration masses in a safe dry place.

5.1 Troubleshooting

SYMPTOM	PROBABLE CAUSE(S)	REMEDY
Unit will not turn on.	Power cord not plugged in or properly connected to balance.	Check power cord connections.
Incorrect weight reading.	Balance was not re-zeroed before weighing. Balance not properly calibrated.	Press # with no weight on the pan, then weigh item. Recalibrate correctly.
Cannot display weight in desired unit.	Desired unit not enabled.	Press Units button until desired measuring unit is shown. Enable units in Setup menu.
Unable to store menu settings/ changes.	Enter was not selected. Menu locked.	Press Enter when prompted. Menu not locked properly.
RS232 interface not working.	Print menu settings not properly set up. Cable connections.	Verify interface settings in RS232 menu correspond to those of peripheral device. Check cable connections.
Random segments displayed or display locks up.	Microprocessor locks up.	Turn power off, then turn on again. If condition persists, unit must be serviced.
Unable to change settings.	Menu locked (Lock Switch set ON)	Set menu Lock OFF. Set Lock Switch to OFF.
Unstable readings.	Excessive air currents. Vibration on table surface.	Check environmental conditions. Place balance on a stable surface or change averaging level.
Error message display.	———	See Error Codes list.
Cannot access weighing mode.	Desired weighing mode is not enabled.	Press mode until desired weighing mode is displayed. Enable weighing mode.

5.2 RS232 Interface

Explorer balances are equipped with a bidirectional RS232 compatible interface for communication with printers and computers. When the balance is connected directly to a printer, displayed data can be output at any time by simply pressing PRINT, or by using the Auto Print feature.

Connecting the balance to a computer enables you to operate the balance from the computer, as well as receive data such as displayed weight, weighing mode, stability status, etc.

The following sections describe the hardware and software provided with the balance

Hardware

On the rear of the balance, the right-hand, 9-pin male subminiature “D” connector is provided for interfacing to other devices. The pinout and pin connections are shown in the adjacent illustration.

The balance will not output any data unless pin 5 (CTS) is held in an ON state (+3 to +15 V dc). Interfaces not utilizing the CTS handshake may tie pin 5 to pin 6 to defeat it.

Output Formats

Data output can be initiated in one of three ways: 1) By pressing PRINT; 2) Using the Auto Print feature; 3) Sending a print command (“P”) from a computer.

The output format is illustrated in the RS232 command table which follows.

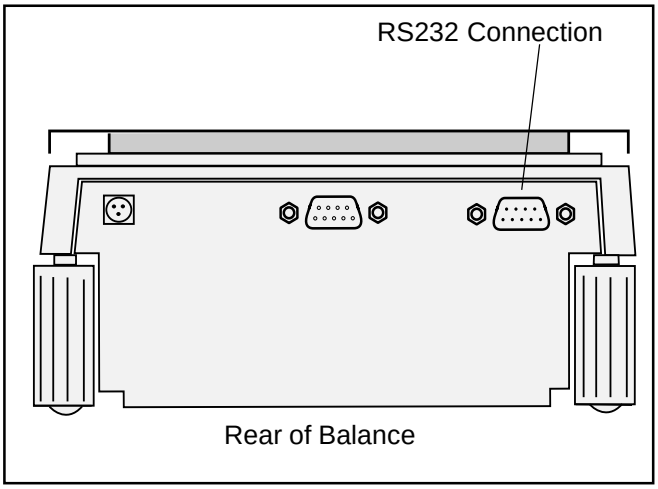

RS232 Commands

All communication is accomplished using standard ASCII format. Characters shown in the following table are acknowledged by the balance. Invalid command response "ES" error indicates the balance has not recognized the command. Commands sent to the balance must be terminated with a carriage return (CR) or carriage return-line line feed (CRLF). For example, a tare command should appear as shown in the adjacent diagram. Data output by the balance is always terminated with a carriage return - line feed (CRLF).

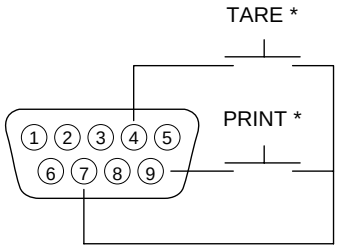

RS232 COMMAND TABLE

Command Character	Description	
?	Print current mode	Field: Mode Stab CR LF Length: 5 1 1 1 blank if stable “ ? ” if unstable mg g kg dwt ct oz oz t GN tael tael tael momme lb N tical custm Pcs %
nnnnA	Set Auto Print feature to “nnnn” (see table).	nnn = 0 Turns feature OFF nnn = S Output on stability nnn = C Output is continuous nnnn = 1-3600 Sets Auto Print Interval

1	N/C
2	Data Out (TXD)
3	Data In (RXD)
4*	Tare (External signal)
5	Clear To Send (CTS)
6	Data Terminal Ready (DTR)
7	Ground
8	Request To Send (RTS)
9*	Print (External signal)

* External PRINT and/or TARE switches may be installed as shown in the diagram. Momentary contact switches must be used.

RS232 COMMAND TABLE (Cont.)

Command Character	Description
C	Begin span calibration
xD	Set 1 second print delay (set x = 0 for OFF, or x = 1 for ON)
F	Print current function.
xI	Set Averaging Filter Level to “x”, where x = 0 to 3 (see table). If LFT, level 0 to 1. 0 = minimum level 1 = 2 = 3 = maximum level
L	Begin linearity calibration
xM	Places balance in mode “x”, where x = 1 to 17 (see table). If unit or mode is not already enabled, command will be ignored. 1 = milligrams 2 = grams 3 = kilo grams 4 = dwt 5 = Carats 6 = Ounces 7 = Ounces troy 8 = Grains 9 = Taels Hong Kong 10 = Taels Singapore 11 = Taels Taiwan 12 = Mommes 13 = Decimal Pounds 14 = (Not used) 15 = Newton's 16 = tical 17 = Custom Units
P	Print display data When "numeric only"data is selected for output in the RS232 menu, the Mode field is not output. Field: Weight | | Mode | Stab | CR | LF Length: 9 | 1 | 5 | 1 | 1 | 1 Same as ? command Displayed weight sent right justified w/lead zero blanking. Nine characters include: decimal point (1) weight (7 max) polarity (1): blank if positive "-" if negative
xSL	Set stable data only printing (set x = 0 to 3). If LFT 0 or 1.
T	Same effect as pressing O/T button.
V	Print EPROM version
Esc V	Print balance ID (13 characters).
xZ	Set Auto Zero to “x”,where x = 0 to 3). 0=Off, 1=0.5d, 2=1d, 3=5d.If LFT, programs Auto zero level from 0 to 1.
x%	Set % reference function. Uses x (Real Number) as current Percent Reference. Reference weigh must be entered in grams.
x#	Set PC reference function Uses x (Real Number) as current Percent Reference. Reference weigh must be entered in grams.

NOTE: Availability of shaded units subject to local regulations.

RS232 COMMAND TABLE (Cont.)

Command Character	Description
Esc R	Resets Setup and Print menus to factory defaults. CAUTION: This will reset RS232 configuration.
ON	Turns balance on.
OFF	Turns balance off.
#	Print current Parts Count Reference Weigh.
%	Print current Percent Reference Weigh.
xF	Set current function, set x for 0=None (normal weigh), 1=percent, 2=parts Counting, 3=Animal Weighing. None
xAW	Set Animal Level from 0 to 3. 0= least amount of filtering.
xE	Set/Reset Auto Restart in Animal mode. Where x is 0=Off and 1=ON.
E	Start Animal cycle.
xT	Download tare, tare weight must be entered in grams.
ID	Print Current User ID String.
xID	Program User ID String, 1-8 characters.
AC	Abort Calibration.
xUC	User Weight Calibration.
IC	Internal calibration (InCAL™)
LE	Show Last Error Code. Response: Err: Error Number.
SN	Show Serial Number.
xS	Print Stable Only. Where x =0 Off and x=1 On.
TIME	Print Current Time. Note, a ? mark will follow if date or time has not been set.
mm/dd/yy SETDATE	Set Date Command and remove Invalid Indicator
hh:mm:ss SETTIME	Set Time Command and Remove Invalid Time Indicator
DATE	Prints Current Date. Note, a ? mark will follow the year if date or time has not been set.
W$TM	Write Clock Trim Value. The clock can be adjusted by + - 60 seconds a month.
R$TM	Read Clock Trim value
SETUP	Program Setup menu Options
SW	Show Lockswitch status.

5.3 Error Codes List

Error Codes List

The following list describes the various error codes and which can appear on the display and the suggested remedy.

Data Errors

1.0 Transient error (hardware error, probably static discharge). If error persists, the balance must be serviced.
1.1 Balance temperature transducer hardware error.

Tare Errors

2.0 Balance is unable to stabilize within time limit after taring. Environment is too hostile or balance needs recalibration.

Calibration Errors

3.0 Incorrect or no calibration mass used for calibration. Recalibrate with correct masses.

RS232 Errors

4.4 RS232 buffer is full.

User Errors

7.0 User entry out of bounds.
7.2 Number outside of display capacity.

Over-Under Load Errors

8.0 Hardware error causing an internal weight signal which is too low. Check if pan is off. If not, the balance must be serviced.
8.1 Hardware error caused by an internal weight signal which is too high. Check load on the pan which may be excessive. If error persists, the balance must be serviced.
8.2 Power-on load out of specification (LFT only)
8.3 Rated capacity exceeded. Remove excessive weight from pan.
8.4 Underload condition on balance. Check that the proper pan is installed.
8.5 Internal calibration weight internal sensor indicated its weight on the pan.

CheckSum Errors

9.1 Bad factory checksum. If error persists, have the balance serviced.
9.2 Bad factory checksum. If error persists, have the balance serviced.
9.3 Bad factory checksum. If error persists, have the balance serviced.
9.4 Factory internal calibration data failed checksum. This failure will disable access to the InCAL™ feature (if installed).
9.5 Factory calibration data failed checksum.
9.8 User calibration data failed checksum.
9.9 Factory temperature compensation data failed checksum.

5.4 Information Messages

CAL NOW If InCAL™ (internal calibration) is installed. Message to recalibrate the balance. The message will remain until calibrated.

WARM UP The user tried to perform an internal calibration and this message will be flashed in the 14 segment field. The balance requires a 7 minute warmup period. During warmup the user can not select InCAL™ from the menu.

SAVED This message is flashed when an item is changed in the menu and the new value is written to the EEPROM.

LOCKED This message is flashed when an item can not be changed in the menu because the menu is locked and the Lock Switch is set locked.

LOW REF The message is flashed in parts counting or percent when the calculated reference weight is very low.

UNSTBLE This message is flashed when the balance was unable to aquire stable data during internal calibration.

5.5 Service Information

If the Troubleshooting section does not resolve or describe your problem, you will need to contact an authorized Ohaus Service Agent. For Service assistance in the United States, please call Aftermarket, Ohaus Corporation toll-free at (800) 526-0659. An Ohaus Product Service Specialist will be available to help you.

5.6 Replacement parts

Description	Ohaus Part No.
Power Pack, 100/120 V ac US Plug (Cord set part of power pack)	490202-01
Power Pack, (Cord set required for UK, European and Australian)	490203-01
Cord Set, 230 V ac, UK Plug	76448-00
Cord Set, 230 V ac, European Plug	76212-00
Cord Set, 230 V ac, Australian plug	76199-01

5.7 Accessories

Description	Ohaus Part No.
Calibration Masses - ASTM Class 1 Tolerance:	
20 g	49024-11
50 g	49054-11
100 g	49015-11
200 g	49025-11
500 g	49055-11
1 kg	49016-11
2 kg	49026-11
4 kg	49046-11
In-Use Display Cover Kit	470003-01
Security Device	470004-01
Draftshield Kit	470006-01
Density Determination Kit	470007-01
Modular Display Upgrade Kit	470008-01
Auxilliary Display Kit	
(Table Mount)	470009-01
(Wall Mount)	470009-02
(Tower Mount)	470009-03
Remote Display Kit	
(Table Mount)	470010-01
(Wall Mount)	470010-02
(Tower Mount)	470010-03
RS232 Interface Cable, Blunt end (user defined)	AS017-01
RS232 Interface Cable, IBM® - PC 25 Pin	AS017-02
RS232 Interface Cable, (connects impact printer)	80500570
RS232 Interface Cable, IBM® - PC 9 Pin	AS017-09
RS232 Interface Cable, Apple® IIGS/Macintosh	AS017-10
Printer	SF42

5.8 Specifications

Analyticals

Capacity (g)	62	110	162	210	100/210 *
Readability (mg)	0.1				0.1/1
Weighing units	g, mg, oz , oz t, ct, dwt, taels (3), mommes, gn, ti, N, custom unit				
Application modes	Parts counting, animal weighing, percent				
Features	GLP, time, date, lockswitch				
Repeatability (Std. dev.) (mg)	0.1				0.1/0.5
Linearity (mg) (±)	0.2				0.2/0.5
Tare range	Full capacity by subtraction				
Safe overload capacity	150 % of capacity				
Stabilization time	≤ 4 seconds				
Sensitivity drift PPM/° C (10° C - 30° C)	3				
Operating temperature range: w/internal calibration w/o internal calibration	10° to 40° C/ 50° to 104° F 10° to 30° C/50° to 86° F				
Calibration	External / InCAL™ calibration				
Power requirements	External Adapter, 100 -120 V ac, 220 - 240 V ac, 50/60 Hz Plug configuration for US, Euro, UK, Japan & Australia				
Draft shield (in/cm) (free height above platform)	10.2/25.9				
Display (in/cm)	0.6/1.5				
Pan size (in/cm)	3.5/9. diameter				
Dimensions (WxHxD) (in/cm)	9 x 15.25 x14/22.8 x 38.7 x 35.5				

Precision Top Loaders

Capacity (g)	210	410	610	100/410*	610	1550	2100	4100	6100	1000/4100*	4100**	6100**	8100**
Readability (g)	0.001			0.001/0.01	0.01					0.01/0.1	0.1		
Weighing units	g, mg, kg, lbs, oz , oz t, ct, dwt, taels (3), mommes, gn, ti, N, custom unit												
Application modes	Parts counting, animal weighing, percent												
Features	GLP, time, date, lockswitch, LFT (U.S.)/type approved												
Repeatability (Std. dev.) (g)	0.0005		0.0015	0.0005/0.005	0.005				0.01	0.01/0.05	0.05		
Linearity (g) (±)	0.002			0.002/0.005	0.02				0.04	0.02/0.05	0.1		
Tare range	Full capacity by subtraction												
Stabilization time	≤ 3 second												
Sensitivity drift PPM/° C (10° C - 30° C)	4	3		4	3	5	4	3		4		3	
Operating temperature range: w/internal calibration w/o internal calibration	10° to 40° C/50° to 104° F 10° to 30° C/50° to 86° F												
Calibration	External / InCAL™ calibration												
Power requirements	External Adapter, 100 -120 V ac, 220 - 240 V ac, 50/60 Hz Plug configuration for US, Euro, UK, Japan & Australia												
Draft shield (in/cm) (free height above platform)	10.2/25.9												
Display (in/cm)	0.6/1.5												
Pan size (in/cm)	4.7/12 Dia.				6.8 x 6.8/17.2 x 17.2 w/windshield								8 x 8/ 20.3 x 20.3 **
Dimensions (WxHxD) (in/cm)	9x15.25x14/22.8x38.7x35.5				8.25 x 4 x 14/20.9 x 10.1 x 35.5								

* Moveable FineRange ™ ** Balances with internal calibration are equipped with a 6" x 6" Pan and Windshield.

NOTE: Not all weighing modes apply depending upon capacity and resolution of the balance.

NOTE: Availability of shaded weighing units subject to local regulations.

Admissible ambient conditions

	Use only in closed rooms
Temperature range:	5 ºC to 40 ºC
Atmospheric humidity:	80% rh @ to 30 ºC
Voltage fluctuations:	–15% +10%
Installation category:	II
Pollution degree:	2

Power supply voltage:	12 V ac, 50/60 Hz or 12 V dc, 1A
Power adapter:	AP2805E 220 - 240V, 50/60 Hz, 100 mA
	AP2805 110 - 120V, 50/60 Hz, 150 mA

LIMITED WARRANTY

Ohaus products are warranted against defects in materials and workmanship from the date of delivery through the duration of the warranty period. During the warranty period Ohaus will repair, or, at its option, replace any component(s) that proves to be defective at no charge, provided that the product is returned, freight prepaid, to Ohaus.

This warranty does not apply if the product has been damaged by accident or misuse, exposed to radioactive or corrosive materials, has foreign material penetrating to the inside of the product, or as a result of service or modification by other than Ohaus. In lieu of a properly returned warranty registration card, the warranty period shall begin on the date of shipment to the authorized dealer. No other express or implied warranty is given by Ohaus Corporation. Ohaus Corporation shall not be liable for any consequential damages.

As warranty legislation differs from state to state and country to country, please contact Ohaus or your local Ohaus dealer for further details.

Ohaus Corporation
19A Chapin Road,
P.O. Box 2033
Pine Brook, NJ 07058-2033, USA
Tel: (973) 377-9000,
Fax: (973) 593-0359

OHAUS UK Ltd
64 Boston Road
Beaumont Leys
Leicester LE4 1AW
England

With offices worldwide.

© Ohaus Corporation 1999, 2002 all rights reserved.
11780302C 0103/2.12